



**2021  
RESERVE STUDY  
CANAL RUN HOMEOWNERS ASSOCIATION, INC**

Point of Rocks, MD 21777

Financial Year 2021 (January 1 2021 - December 31 2021)

Level 2 Update with Site Visit

06/01/21



## A New Strategy for Reserve Funding.

Our reserve study approach is simple. We provide you with the insight needed to make fast, accurate and informed decisions. We focus on understanding your situation and providing funding solutions that are designed with your goals in mind. By focusing on the detail and the big picture we provide the information you need to best manage your reserve fund and annual contributions.

As a long-term capital budget plan, the reserve study identifies the current status of the reserve fund and whether contributions to the fund are adequate to address future needs. The report helps the Association make necessary decisions regarding the development of their reserve fund and establish expectations in relation to the timing and cost of significant repair and replacement projects.

The reserve study recommends funding through smaller monthly contributions rather than risking large, unanticipated special assessments. Regular and ongoing reserve contributions are favored over special assessment as they help distribute expenses equally between current and future owners, and establish a stable contribution rate.

The reserve study contains 'forward looking' concepts which reflect expectations with respect to certain future events and potential financial performance. Although we believe at this time that the expectations reflected within the reserve study are reasonable, no assurances can be given that such expectations will prove correct. We recommend that the reserve study be updated annually to address changing circumstances and conditions.



## 9 CONTRIBUTION RANGE

Funding programs and strategies that are available to the Association.



## 15 PERCENT FUNDED

How well funded is the Association's reserve fund.

## 4 EXECUTIVE SUMMARY

Summary of reserve study outcomes and property related data.

## 5 KEY INSIGHTS

Snapshot of key data points, highlighting the strength of current funding strategies.

## 9 CURRENT FUNDING SUMMARY

Summary of current funding strategies and projected outcomes.

## 10 METHODOLOGY

The what, when, when and how of the reserve study process.

## 15 FINANCIAL ANALYSIS

Percent funded and the strength of the reserve account.

## 17 RESERVE COMPONENT LIST

List of reserve components, anticipated cost, remaining, and useful life estimates.

## 18 RESERVE EXPENSES

Projected expenses over the coming 30 years.

## 21 FULL FUNDING PLAN

Recommended funding plan and cash flow projection.

## 24 PHYSICAL ANALYSIS

Specific information regarding the physical condition of the property.

---

**RESERVE STUDY GROUP** This work is copyright and has been supplied under contract to the Association and/or its representatives. Apart from the client's right to reproduce and distribute copies of the report as required by its governing documents or state law, no part of this work may be reproduced by any process without the written permission from Reserve Study Group, LLC. Requests and inquiries concerning reproduction and rights should be addressed to the Reserve Study Group, 701 Fifth Ave, Suite 4200, Seattle WA 98104.



# EXECUTIVE SUMMARY

## PROPERTY SUMMARY

ASSOCIATION NAME	Canal Run Homeowners Association, Inc
LOCATION	Point of Rocks, MARYLAND 21777
YEAR CONSTRUCTED	1997-2015
NUMBER OF UNITS	324
FINANCIAL YEAR	2021 (January 1 2021 - December 31 2021)
REPORT LEVEL	Level 2 Update with Site Visit

## RESERVE FUND

PROJECT STARTING BALANCE <sup>1</sup>	\$242,870
FULLY FUNDED BALANCE, IDEAL	\$298,182
CURRENT PER UNIT DEFICIENCY/(SURPLUS) IN RESERVES	\$171
PERCENT FUNDED <sup>2</sup>	81 %
INTEREST EARNED	1.00 %
INFLATION RATE <sup>3</sup>	3.00 %

## RESERVE CONTRIBUTIONS

CURRENT RESERVE FUND CONTRIBUTION	\$39,000
FULL FUNDING, MAXIMUM CONTRIBUTION	\$49,391
BASELINE FUNDING, MINIMUM CONTRIBUTION	\$34,339
SPECIAL ASSESSMENT	\$0

<sup>1</sup> Information in relation to the Association's finances were supplied by the Association's representative and is not audited.

<sup>2</sup> The ratio, at a particular point of time (the beginning of the Fiscal Year), of the actual (or projected) Reserve Balance to the Fully Funded Balance, expressed as a percentage ([www.caionline.org](http://www.caionline.org)). Used to highlight the strength of the Association's reserve fund.

<sup>3</sup> Inflation rate is based upon the average annual increase of the Consumer Price Index (CPI) over the last 30-years, as published by the US Bureau of Labor Statistics ([www.labor.gov](http://www.labor.gov)).



## KEY INSIGHTS

**\$242,870**

RESERVE ACCOUNT  
BALANCE

**\$39,000**

ANNUAL  
RESERVE CONTRIBUTION


**\$1,937,783**

PROJECTED EXPENSES  
OVER 30 YEARS

## FULL FUNDING STRATEGY

Annual member contributions to the reserve fund are used to address those expenses too large or infrequent to be addressed through annual operating funds. The chart below highlights the outcome of the Full Funding strategy over the mid-to-long term.

YEAR 1-30 EXPENSES  
**\$1,937,783**

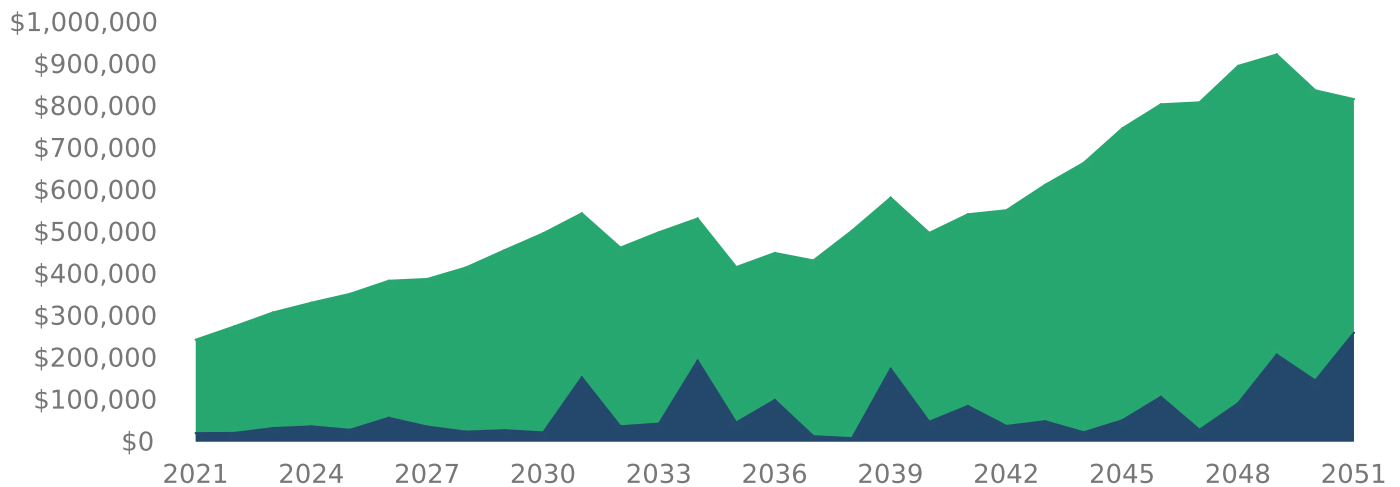

STARTING BALANCE

**\$242,870**

ENDING BALANCE


**\$816,441**

Note: Figures based upon the expectation that the Association will continue to increase member contributions by an inflationary rate of 3.00% annually. Year-over-year change the result of projected expenses on the Association's reserve account.




## CONTRIBUTION RANGE

We recommend that reserve contributions be evenly distributed between members over the life of a community. To achieve this goal, we establish an ideal contribution range within which the Association should establish ongoing payments.

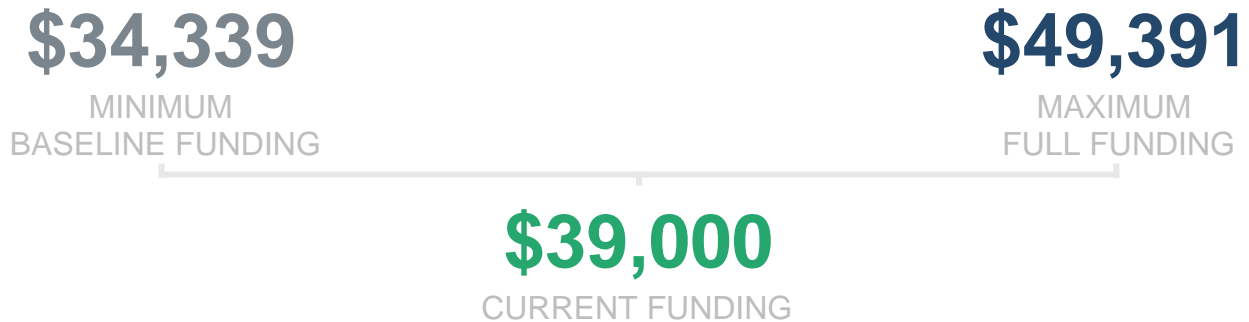

## FUNDING STRATEGIES

The funding strategy chosen will have a direct impact on the growth of the Association’s reserve fund. The chart below highlights the outcomes of the various funding strategies.

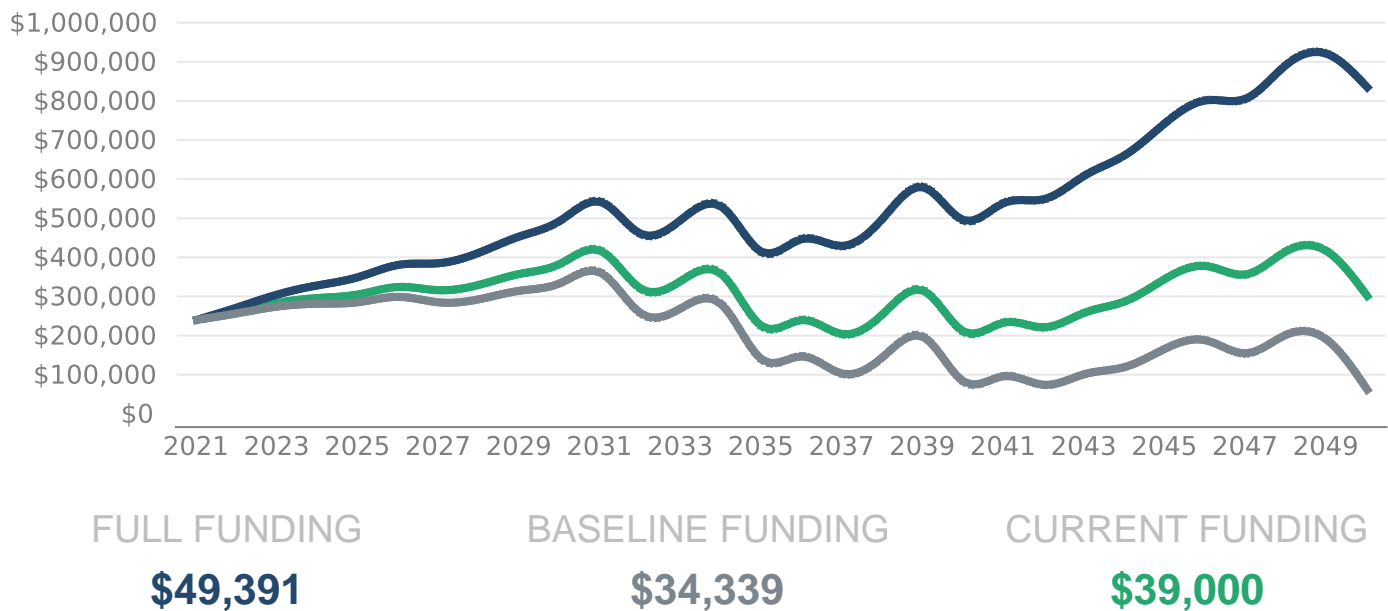

Note: Figures based upon the expectation that the Association will continue to increase member contributions by an inflationary rate of 3.00% annually. Year-over-year change the result of projected expenses on the Association’s reserve account.



# FULL FUNDING PLAN | SUMMARY

Year	Fully Funded Balance	Percentage Funded	Beginning Balance	Reserve Contribution	Special Assessment	Interest Earned	Reserve Expenditures	Ending Balance
2021	\$298,182	81%	\$242,870	\$49,391	\$0	\$2,575	\$20,190	\$274,646
2022	\$328,392	84%	\$274,646	\$50,873	\$0	\$2,898	\$20,649	\$307,766
2023	\$360,296	85%	\$307,766	\$52,399	\$0	\$3,179	\$32,198	\$331,146
2024	\$382,563	87%	\$331,146	\$53,971	\$0	\$3,400	\$36,246	\$352,271
2025	\$402,667	87%	\$352,271	\$55,590	\$0	\$3,660	\$28,138	\$383,383
2026	\$433,104	89%	\$383,383	\$57,258	\$0	\$3,836	\$56,731	\$387,746
2027	\$436,423	89%	\$387,746	\$58,975	\$0	\$3,994	\$35,700	\$415,016
2028	\$462,967	90%	\$415,016	\$60,745	\$0	\$4,335	\$23,786	\$456,310
2029	\$504,085	91%	\$456,310	\$62,567	\$0	\$4,740	\$27,216	\$496,400
2030	\$544,456	91%	\$496,400	\$64,444	\$0	\$5,177	\$21,855	\$544,166
2031	\$593,158	92%	\$544,166	\$66,377	\$0	\$5,008	\$153,059	\$462,493
2032	\$509,827	91%	\$462,493	\$68,369	\$0	\$4,784	\$36,527	\$499,119
2033	\$545,720	91%	\$499,119	\$70,420	\$0	\$5,129	\$42,915	\$531,752
2034	\$577,856	92%	\$531,752	\$72,532	\$0	\$4,715	\$193,002	\$415,998
2035	\$458,167	91%	\$415,998	\$74,708	\$0	\$4,307	\$45,378	\$449,635
2036	\$488,793	92%	\$449,635	\$76,950	\$0	\$4,385	\$99,136	\$431,834
2037	\$466,874	92%	\$431,834	\$79,258	\$0	\$4,650	\$12,915	\$502,827
2038	\$535,073	94%	\$502,827	\$81,636	\$0	\$5,395	\$8,264	\$581,594
2039	\$612,132	95%	\$581,594	\$84,085	\$0	\$5,369	\$173,546	\$497,501
2040	\$523,348	95%	\$497,501	\$86,607	\$0	\$5,171	\$47,380	\$541,900
2041	\$564,000	96%	\$541,900	\$89,206	\$0	\$5,440	\$84,960	\$551,586
2042	\$569,377	97%	\$551,586	\$91,882	\$0	\$5,789	\$37,295	\$611,962
2043	\$626,288	98%	\$611,962	\$94,638	\$0	\$6,350	\$48,573	\$664,377
2044	\$675,638	98%	\$664,377	\$97,477	\$0	\$7,020	\$22,193	\$746,682
2045	\$756,058	99%	\$746,682	\$100,402	\$0	\$7,715	\$50,820	\$803,978
2046	\$811,895	99%	\$803,978	\$103,414	\$0	\$8,024	\$106,650	\$808,766
2047	\$814,467	99%	\$808,766	\$106,516	\$0	\$8,480	\$28,139	\$895,622
2048	\$900,624	99%	\$895,622	\$109,712	\$0	\$9,047	\$91,495	\$922,886
2049	\$926,830	100%	\$922,886	\$113,003	\$0	\$8,757	\$207,309	\$837,338
2050	\$837,338	100%	\$837,338	\$116,393	\$0	\$8,228	\$145,518	\$816,441

**\$49,391**

2021  
ANNUAL CONTRIBUTION

**3.00 %**

PERCENTAGE ANNUAL  
CONTRIBUTION INCREASE

**1.00 %**

ANNUAL  
INTEREST RATE



# BASELINE FUNDING PLAN | SUMMARY

Year	Fully Funded Balance	Percentage Funded	Beginning Balance	Reserve Contribution	Special Assessment	Interest Earned	Reserve Expenditures	Ending Balance
2021	\$298,182	81%	\$242,870	\$34,339	\$0	\$2,499	\$20,190	\$259,518
2022	\$328,392	79%	\$259,518	\$35,369	\$0	\$2,669	\$20,649	\$276,906
2023	\$360,296	77%	\$276,906	\$36,430	\$0	\$2,790	\$32,198	\$283,928
2024	\$382,563	74%	\$283,928	\$37,523	\$0	\$2,846	\$36,246	\$288,051
2025	\$402,667	72%	\$288,051	\$38,649	\$0	\$2,933	\$28,138	\$301,495
2026	\$433,104	70%	\$301,495	\$39,808	\$0	\$2,930	\$56,731	\$287,502
2027	\$436,423	66%	\$287,502	\$41,002	\$0	\$2,902	\$35,700	\$295,707
2028	\$462,967	64%	\$295,707	\$42,232	\$0	\$3,049	\$23,786	\$317,202
2029	\$504,085	63%	\$317,202	\$43,499	\$0	\$3,253	\$27,216	\$336,739
2030	\$544,456	62%	\$336,739	\$44,804	\$0	\$3,482	\$21,855	\$363,170
2031	\$593,158	61%	\$363,170	\$46,148	\$0	\$3,097	\$153,059	\$259,357
2032	\$509,827	51%	\$259,357	\$47,533	\$0	\$2,649	\$36,527	\$273,011
2033	\$545,720	50%	\$273,011	\$48,959	\$0	\$2,760	\$42,915	\$281,815
2034	\$577,856	49%	\$281,815	\$50,428	\$0	\$2,105	\$193,002	\$141,346
2035	\$458,167	31%	\$141,346	\$51,940	\$0	\$1,446	\$45,378	\$149,355
2036	\$488,793	31%	\$149,355	\$53,499	\$0	\$1,265	\$99,136	\$104,983
2037	\$466,874	22%	\$104,983	\$55,104	\$0	\$1,261	\$12,915	\$148,433
2038	\$535,073	28%	\$148,433	\$56,757	\$0	\$1,727	\$8,264	\$198,652
2039	\$612,132	32%	\$198,652	\$58,459	\$0	\$1,411	\$173,546	\$84,977
2040	\$523,348	16%	\$84,977	\$60,213	\$0	\$914	\$47,380	\$98,725
2041	\$564,000	18%	\$98,725	\$62,020	\$0	\$873	\$84,960	\$76,657
2042	\$569,377	13%	\$76,657	\$63,880	\$0	\$899	\$37,295	\$104,142
2043	\$626,288	17%	\$104,142	\$65,797	\$0	\$1,128	\$48,573	\$122,492
2044	\$675,638	18%	\$122,492	\$67,771	\$0	\$1,453	\$22,193	\$169,523
2045	\$756,058	22%	\$169,523	\$69,804	\$0	\$1,790	\$50,820	\$190,297
2046	\$811,895	23%	\$190,297	\$71,898	\$0	\$1,729	\$106,650	\$157,274
2047	\$814,467	19%	\$157,274	\$74,055	\$0	\$1,802	\$28,139	\$204,992
2048	\$900,624	23%	\$204,992	\$76,276	\$0	\$1,974	\$91,495	\$191,747
2049	\$926,830	21%	\$191,747	\$78,565	\$0	\$1,274	\$207,309	\$64,277
2050	\$837,338	8%	\$64,277	\$80,922	\$0	\$320	\$145,518	\$0

**\$34,339**

2021  
ANNUAL CONTRIBUTION

**3.00 %**

PERCENTAGE ANNUAL  
CONTRIBUTION INCREASE

**1.00 %**

ANNUAL  
INTEREST RATE





# CURRENT FUNDING PLAN | SUMMARY

Year	Fully Funded Balance	Percentage Funded	Beginning Balance	Reserve Contribution	Special Assessment	Interest Earned	Reserve Expenditures	Ending Balance
2021	\$298,182	81%	\$242,870	\$39,000	\$0	\$2,523	\$20,190	\$264,203
2022	\$328,392	80%	\$264,203	\$40,170	\$0	\$2,740	\$20,649	\$286,463
2023	\$360,296	80%	\$286,463	\$41,375	\$0	\$2,911	\$32,198	\$298,550
2024	\$382,563	78%	\$298,550	\$42,616	\$0	\$3,017	\$36,246	\$307,938
2025	\$402,667	76%	\$307,938	\$43,895	\$0	\$3,158	\$28,138	\$326,853
2026	\$433,104	75%	\$326,853	\$45,212	\$0	\$3,211	\$56,731	\$318,545
2027	\$436,423	73%	\$318,545	\$46,568	\$0	\$3,240	\$35,700	\$332,653
2028	\$462,967	72%	\$332,653	\$47,965	\$0	\$3,447	\$23,786	\$360,280
2029	\$504,085	71%	\$360,280	\$49,404	\$0	\$3,714	\$27,216	\$386,181
2030	\$544,456	71%	\$386,181	\$50,886	\$0	\$4,007	\$21,855	\$419,219
2031	\$593,158	71%	\$419,219	\$52,413	\$0	\$3,689	\$153,059	\$322,262
2032	\$509,827	63%	\$322,262	\$53,985	\$0	\$3,310	\$36,527	\$343,030
2033	\$545,720	63%	\$343,030	\$55,605	\$0	\$3,494	\$42,915	\$359,213
2034	\$577,856	62%	\$359,213	\$57,273	\$0	\$2,913	\$193,002	\$226,397
2035	\$458,167	49%	\$226,397	\$58,991	\$0	\$2,332	\$45,378	\$242,343
2036	\$488,793	50%	\$242,343	\$60,761	\$0	\$2,232	\$99,136	\$206,199
2037	\$466,874	44%	\$206,199	\$62,584	\$0	\$2,310	\$12,915	\$258,178
2038	\$535,073	48%	\$258,178	\$64,461	\$0	\$2,863	\$8,264	\$317,238
2039	\$612,132	52%	\$317,238	\$66,395	\$0	\$2,637	\$173,546	\$212,723
2040	\$523,348	41%	\$212,723	\$68,387	\$0	\$2,232	\$47,380	\$235,963
2041	\$564,000	42%	\$235,963	\$70,438	\$0	\$2,287	\$84,960	\$223,728
2042	\$569,377	39%	\$223,728	\$72,551	\$0	\$2,414	\$37,295	\$261,398
2043	\$626,288	42%	\$261,398	\$74,728	\$0	\$2,745	\$48,573	\$290,298
2044	\$675,638	43%	\$290,298	\$76,970	\$0	\$3,177	\$22,193	\$348,251
2045	\$756,058	46%	\$348,251	\$79,279	\$0	\$3,625	\$50,820	\$380,335
2046	\$811,895	47%	\$380,335	\$81,657	\$0	\$3,678	\$106,650	\$359,021
2047	\$814,467	44%	\$359,021	\$84,107	\$0	\$3,870	\$28,139	\$418,859
2048	\$900,624	47%	\$418,859	\$86,630	\$0	\$4,164	\$91,495	\$418,159
2049	\$926,830	45%	\$418,159	\$89,229	\$0	\$3,591	\$207,309	\$303,670
2050	\$837,338	36%	\$303,670	\$91,906	\$0	\$2,769	\$145,518	\$252,827

**\$39,000**

2021  
ANNUAL CONTRIBUTION

**3.00 %**

PERCENTAGE ANNUAL  
CONTRIBUTION INCREASE

**1.00 %**

ANNUAL  
INTEREST RATE



## METHODOLOGY

---

An important aspect of living in a common area development such as a cooperative, condominium, or homeowner Association is the community's ownership and commitment to maintain its common areas.

---

Association members have a vested interest in maintaining and preserving their investment. To meet these obligations, the Association should prudently prepare for the future and contribute funds into a reserve account. Periodic contributions provide the freedom to gradually accumulate funds for anticipated expenditures while limiting the need to raise large sums of money through alternative means, such as special assessments.

When implementing a policy to fund major repair or replacement, the Board must educate owners about the benefits of accumulating reserve funds in advance through periodic contributions. Benefits of a systematic accumulation of funds include:

- having assurance that funds for major repairs and replacements will be available when needed;
- development of an equitable method of charging both current and future owners for ongoing use of assets;
- preservation of the market value of individual units; and
- compliance with the governing documents, statutes, mortgages, and other similar requirements.

A reserve study recommends the preferable mode of funding through smaller monthly contributions rather than facing large, unanticipated special assessments. The reserve study provides an Association with access to information and materials that will assist them in making timely and informed decisions about their reserve fund and contributions.

A reserve study is the sum of two parts: the physical and financial analysis. The physical analysis is a result of the on-site collection and review of data specific to the property's reserve components, common areas, and limited common areas. Through an onsite inspection and the use of source materials, the Reserve Specialist quantifies and establishes the reserve component inventory and assesses the physical condition of the Association's reserve components. Data from the physical analysis is used to define the scope and timing of future anticipated expenses.

The financial analysis evaluates the condition of the Association's reserve fund in relation to its income and anticipated expenses. It appraises the adequacy of the reserve fund, and associated member contributions, against the current and future expenditures of the Association. To adequately forecast these expenditures over the 30-year projection period, current costs, projected inflation, and interest rates must be established. Recommendations are then provided to establish a reserve fund that addresses anticipated expenses, without having to resort to special assessments.

Due to the long-term nature of a reserve study, certain assumptions must be made. Every effort has been made to ensure that the recommendations are based upon reliable and experienced sources in the building industry. However, there can be no guarantee that events will occur at the predicted specific intervals, or that they will occur at all. Any reserve study must be viewed in the light of circumstances existing at the actual time of the study.



## PHYSICAL ANALYSIS

As part of this reserve study a comprehensive list of reserve components (major common and limited common elements) has been compiled. Estimates for the useful life, remaining life, plus current repair and replacement costs for each of these reserve components have been calculated. This list is not intended to be exhaustive. However, an inaccurate or incomplete list of components can have an adverse impact upon the Association's long-term funding plan.

### Site Inspection

A site inspection is conducted to assess the general condition of the property and its common areas. The on-site inspection is visual in nature, and no destructive or invasive testing is conducted. Observations are recorded using a representative sampling of the Association's common areas and reserve components. The component inventory and associated field measurements are also substantiated as part of the inspection.

### Reserve Components

Determination of what constitutes a reserve component is dependent on a number of factors. A four-part test is generally used to distinguish a reserve item from an operational or maintenance expense. A component is included as a reserve item only if it satisfies ALL criteria outlined below:

- It is part of the Association's common and limited common area responsibilities.
- It has a predictable useful service life.
- Its useful life fits within the projection period. This means that components with a life of 30 years or more may not be included as part of the report if it is determined that they will last beyond the projection period.
- Its cost for repair or replacement is too high to include as part of the operating budget.

The components of common property that an Association includes in its reserve funding plan are also dependent on the type of project, the construction properties and the Association's applicable governing documents and state statutes.

### Component Useful Life

The useful life of a reserve component relates to the number of years it is expected to last, given reasonable care and maintenance. The prediction of reserve and building component life can be no more than an informed estimate based upon information made available at the time of the report's development. Consideration is given to vendor recommendations, material warranty information provided at the time of the report's development, along with other published sources. The data and service life estimates in this report are based on information gathered from various groups and industry sources as outlined below:

- Historical data and feedback from the Association;
- Management groups and maintenance managers;
- Manufacturer recommendations and industry standards;
- Published sources of service life data;
- Manufacturers' and suppliers' data.



## Component Remaining Useful Life

The remaining life of a reserve component refers to the number of years left before an item's expected repair or replacement. A component's remaining life is contingent upon the following factors:

- Age/years in service;
- Physical condition;
- Frequency and quality of inspections and maintenance;
- General use;
- Environment, impact of weather and building location;
- Installation methods that meets or exceed industry standards;
- Design and quality of materials used.

In addition to deterioration or anticipated failure of a component, the longevity may be impacted by obsolescence. The accuracy of the estimate is contingent upon reliable information made available at the time of the report's development. It is important to note that even with the highest degree of diligence and experience, outcomes will vary, and no guarantee can be given as to the timing or service life of the reserve components. All service life assessments in this report are based on the assumption that installation is carried out in accordance with manufacturer's recommendations and installation instructions, together with industry standards of workmanship.

## FINANCIAL ANALYSIS

An Association, like any business entity, must prepare financially for the replacement and repair of its assets. Reserve study funding analysis is an important part of the annual budget process. Reserve funding should be reviewed at least once annually to help determine the annual assessment to be charged to members. The following elements are used in the financial analysis.

### Recommended Funding Rate

We advocate a program of regular reserve fund contributions and promote a gradual means of reserving for future repair and replacement expenses. Recommended contributions are set at a level where they require only minor annual increases. The rate is designed to distribute the anticipated cost of common property ownership equitably between all members over the entire projection period.

### Fully Funded Balance

The Fully Funded balance is equal to the total depreciable cost of all the Association's reserve components. It is determined by dividing each reserve component's cost by its useful life, and multiplying that by the number of years the component has been in service (effectively its age). In essence, the depreciated or 'used up' value of a component is utilized to establish an amount that the Association should have saved by a particular time. The recommendations in this report are based upon a Full Funding plan, which sets the goal of achieving one hundred percent fully funded reserves by the end of the 30-year projection period. We advocate full funding as we feel that this approach provides a solid platform to address future needs, thus dramatically reducing the need for special assessment.



## Percent Funded

An Association's reserve fund status is assessed by comparing the ratio of actual or projected funds available versus how much they 'should have saved'. The result is presented as a percentage and is commonly known as "percent funded". In other words, percent funded is calculated by dividing the Association's current reserve fund balance by the fully funded balance. This equation is an industry measure of how well prepared an Association is to meet its current and future repair and replacement obligations. Percent funded highlights the strength of the Association's reserve account in relation to the anticipated costs of repair and replacement.

## Reserve Component Cost

Current cost estimates for reserve components are derived from a variety of sources but typically are based on cost data sourced from national construction estimators (R.S. Means) and vendor pricing acquired from regional contractors and suppliers. All cost estimates formulated from national estimators are based upon the latest specific geographical information for the area. Future cost estimates are determined by applying the assumed annual inflation rate to the current cost of each component.

Individual cost estimates are for budgeting purposes only. Actual construction costs can vary significantly due to economies of scale, material availability, labor, seasonal considerations, and other factors beyond our control. We recommend that project costs be substantiated well in advance of the anticipated date of repair and replacement. A detailed evaluation by a qualified professional should also be undertaken to establish the scope and budget of each project.

Cost estimates do not account for permits, architectural, or project management fees that may be required. Allowances and contingencies must also be added to the total as the scope of work is defined.

## Inflation Rate

The effect of inflation on the cost of reserve components is a key factor in the financial projections. Historically, the cost of construction materials and labor rise at a higher rate than that experienced by the general economy. RSG has chosen to use an inflationary multiplier that is somewhat higher than the current general consumer index for inflation. The rate used is based upon the historical average of inflation over the last 30 years. This rate reflects a realistic appreciation of future costs for reserve components and assists the Association in adequately budgeting for increasing cost.

## Interest Rate

The interest rate used in this report is formulated on a conservative rate of return. Unless otherwise advised by the Association, an assumed net interest rate of 1.00% is used. RSG offers no guarantee or opinion in relation to investment decisions made by the Association or the rate of return achieved.

## Current Reserve Fund Balance

The analysis, recommendations, and financial projections made within this report are heavily reliant on information provided by the Association and its representatives. The starting reserve fund balance (current or projected) and member contribution totals are supplied by these sources. This information has not been audited nor have the financial projections or recommendations.



## FINANCIAL ANALYSIS

This section of the report is intended to provide the association with the awareness to adequately plan for the ongoing major maintenance, repair and replacement of their common property components. The recommendations included within this report represent one scenario, and are not intended to represent the only means of achieving the association's goals. We recommend that the Board of Directors use the following information as a guide in planning for their future objectives.

### Percent Funded

The Percent Funded equation is the industry measure of how well prepared an association is to meet its current and future repair and replacement obligations. Percent funded highlights the strength of the association's reserve account in relation to its anticipated costs of repair and replacement. The higher the funded level, the less exposed an association is to market conditions, unanticipated expenses or events, and fluctuations in the general economy.

PERCENT  
FUNDED

**81%**



RESERVE FUND  
BALANCE

**\$242,870**

IDEAL  
BALANCE

**\$298,182**

An Association at or below a funding level of 30% has an increased risk of requiring special assessments to meet their ongoing obligations, as compared to Associations with higher funding levels. A level of funding at and above 60% is categorized as good or well funded. We recommend that associations look to achieve and maintain funding levels at and above 60%, with a preference to being 100% funded.



## Funding Goals

There is a range of funding alternatives available to the association. In our opinion the strategy chosen should not only meet the immediate needs and risk tolerance of current members, but also the longer term needs of the association.

The association needs to establish a reserve contribution rate which, at a minimum, meets their anticipated financial needs without having to resort to special assessment or deferred maintenance. In addition, the funding goal needs to be prudent enough to meet the expectations of current members while not unfairly burdening future owners.



### **FULL FUNDING**

Establishes a goal of achieving one hundred percent fully funded reserves by the end of the projection period.

### **THRESHOLD FUNDING**

Sets out to keep the cash reserves above a specified dollar or percent funded amount for the duration of the projection period.

### **BASELINE FUNDING**

Establishes a goal of maintaining a reserve account balance above zero dollars throughout the study period.

The minimum funding goal needed to meet planned expenditure is Baseline Funding. Baseline Funding maintains the reserve account at or above zero dollars, but leaves the association with no contingency to address unanticipated outcomes. Threshold funding is a strategy designed to provide for this contingency by keeping cash reserves above a specific dollar amount or percent funded level.

The reserve fund plan highlighted in this report is based upon the Full Funding program of reserve contributions. The Full Funding plan highlights an ideal level of contributions which will enable an association to be 100% funded by the end of the projection period. As stated previously, we recommend that the association implement a program that moves them toward and maintains a funding level of 60-100%.



# RESERVE COMPONENT LIST

Component	Useful Life	Remaining Useful Life	Quantity	Unit of Measure	Unit Cost	Current Cost
<b>General Site</b>						
General Site - Paving, Asphalt Repair & Overlay	20	10	5780	SY	\$15.00	\$86,700
General Site - Paving, Asphalt Repair	5	0	5780	SY	\$2.50	\$14,450
General Site - Walkways, Asphalt, 10% Replace	10	5	5277	SY	\$45.00	\$23,747
General Site - Sidewalks, Concrete, 2% Replace	5	3	12004	SF	\$11.25	\$2,701
General Site - Curbs & Gutters, Concrete, 2% Replace	5	3	2755	LF	\$40.00	\$2,204
General Site - Stormwater System, Pond Aeration Fountain	10	1	1	Lump Sum	\$12,000.00	\$12,000
General Site - Stormwater System, Repair & Maintain	10	4	1	Allowance	\$20,000.00	\$20,000
General Site - Landscape, Tree Remove & Replace	3	2	1	Allowance	\$5,000.00	\$5,000
General Site - Mailboxes	20	9	3	Each	\$2,250.00	\$6,750
General Site - Signage, Entry Monuments, Repair	10	9	1	Allowance	\$5,000.00	\$5,000
Building Exterior - Signage, Entry Monuments, Replace	40	29	1	Lump Sum	\$40,000.00	\$40,000
General Site - Signage, Street & Informational	20	8	9	Each	\$170.00	\$1,530
General Site - Playgrounds, Equipment & Site Furniture	25	13	5	Each	\$17,500.00	\$87,500
General Site - Gazebo	25	13	1	Allowance	\$7,000.00	\$7,000
General Site - Pedestrian Bridge, Wood	20	12	1	Allowance	\$4,750.00	\$4,750
Electrical - Light Fixtures, Entry Monuments	15	3	1	Allowance	\$2,250.00	\$2,250
Electrical - Light Fixtures, Lamp Posts, 2% Replace	4	3	134	Each	\$500.00	\$1,340
<b>Clubhouse</b>						
Building Exterior - Roof, Metal Standing Seam	40	28	27	Squares	\$1,500.00	\$40,500
Building Exterior - Stone Veneer, 10% Repair	10	2	1	Lump Sum	\$16,000.00	\$1,600
Building Exterior - Wood Trim, Repair	10	2	1	Lump Sum	\$5,300.00	\$5,300
Building Exterior - Doors & Windows	40	28	1	Lump Sum	\$28,000.00	\$28,000
Building Exterior - Balcony, Railings & Decking	25	19	448	SF	\$35.00	\$15,680
Building Interior - Paint, Walls & Ceiling	15	3	1	Lump Sum	\$6,000.00	\$6,000
Building Interior - Flooring, Tile	30	18	589	SF	\$15.00	\$8,835
Building Interior - Flooring, Dry-Dek	15	3	1040	SF	\$6.25	\$6,500
Building Interior - Kitchen, Remodel	30	18	1	Lump Sum	\$8,000.00	\$8,000
Building Interior - Restrooms, Remodel	30	18	1	Lump Sum	\$15,000.00	\$15,000
Building Interior - Doors	30	18	5	Each	\$700.00	\$3,500
Building Interior - Fitness Equipment	10	2	1	Lump Sum	\$8,450.00	\$8,450
Building Interior - Fixtures & Furnishings	10	8	1	Allowance	\$8,775.00	\$8,775
Mechanical - HVAC, Split-System AHU	15	3	1	Each	\$7,000.00	\$7,000
Mechanical - HVAC, Split-System AHU	15	10	1	Each	\$7,000.00	\$7,000
Electrical - Security System	15	3	1	Lump Sum	\$5,175.00	\$5,175
Electrical - General System, Modernize	40	28	1	Allowance	\$5,625.00	\$5,625
Electrical - Light Fixtures, Interior	20	7	40	Each	\$225.00	\$9,000
Plumbing - Water Heater, 30 Gal.	20	8	1	Each	\$1,275.00	\$1,275
Plumbing - Water Heater, 85 Gal.	20	7	1	Each	\$9,000.00	\$9,000
Plumbing - General System, Modernize	30	18	1	Lump Sum	\$26,000.00	\$26,000
General Site - Metal Handrails	25	13	226	LF	\$45.00	\$10,170
<b>Pool</b>						
General Site - Pool, Concrete Deck, 5% Repair	5	0	8504	SF	\$13.50	\$5,740



Component	Useful Life	Remaining Useful Life	Quantity	Unit of Measure	Unit Cost	Current Cost
<b>Pool</b>						
General Site - Pool, Resurface, White Coat	7	6	3496	SF	\$6.25	\$21,850
General Site - Pool, Coping, Replace	28	15	319	LF	\$45.00	\$14,355
General Site - Pool, Accessories	25	15	1	Lump Sum	\$4,000.00	\$4,000
General Site - Pool, Furniture	5	4	1	Allowance	\$5,000.00	\$5,000
General Site - Pool, Equipment	10	2	1	Allowance	\$10,000.00	\$10,000
General Site - Pool, Cover	5	1	2012	SF	\$4.00	\$8,048
<b>TOTALS</b>						<b>\$628,300</b>

Readers should be aware that certain property elements are considered 'long life' elements and are not accounted for within the reserve study [building foundations, utility piping, structural, plumbing & electrical elements] in conjunction with elements that are or can be managed as part of the Association's operating budget.

Cost estimates do not account for permits, architectural, or project management fees that may be required. Allowances and contingencies must also be added to the total as the scope of work is defined.



# FULLY FUNDED BALANCE

Component	Current Cost	Current Fully Funded Balance	Annual Cost	% Annual Cost
<b>General Site</b>				
General Site - Paving, Asphalt Repair & Overlay	\$86,700	\$43,350	\$4,335	10.62%
General Site - Paving, Asphalt Repair	\$14,450	\$14,450	\$2,890	7.08%
General Site - Walkways, Asphalt, 10% Replace	\$23,747	\$11,873	\$2,375	5.82%
General Site - Sidewalks, Concrete, 2% Replace	\$2,701	\$1,080	\$540	1.32%
General Site - Curbs & Gutters, Concrete, 2% Replace	\$2,204	\$882	\$441	1.08%
General Site - Stormwater System, Pond Aeration Fountain	\$12,000	\$10,800	\$1,200	2.94%
General Site - Stormwater System, Repair & Maintain	\$20,000	\$12,000	\$2,000	4.90%
General Site - Landscape, Tree Remove & Replace	\$5,000	\$1,667	\$1,667	4.08%
General Site - Mailboxes	\$6,750	\$3,713	\$338	0.83%
General Site - Signage, Entry Monuments, Repair	\$5,000	\$500	\$500	1.22%
Building Exterior - Signage, Entry Monuments, Replace	\$40,000	\$11,000	\$1,000	2.45%
General Site - Signage, Street & Informational	\$1,530	\$918	\$77	0.19%
General Site - Playgrounds, Equipment & Site Furniture	\$87,500	\$42,000	\$3,500	8.57%
General Site - Gazebo	\$7,000	\$3,360	\$280	0.69%
General Site - Pedestrian Bridge, Wood	\$4,750	\$1,900	\$238	0.58%
Electrical - Light Fixtures, Entry Monuments	\$2,250	\$1,800	\$150	0.37%
Electrical - Light Fixtures, Lamp Posts, 2% Replace	\$1,340	\$335	\$335	0.82%
<b>Clubhouse</b>				
Building Exterior - Roof, Metal Standing Seam	\$40,500	\$12,150	\$1,013	2.48%
Building Exterior - Stone Veneer, 10% Repair	\$1,600	\$1,280	\$160	0.39%
Building Exterior - Wood Trim, Repair	\$5,300	\$4,240	\$530	1.30%
Building Exterior - Doors & Windows	\$28,000	\$8,400	\$700	1.71%
Building Exterior - Balcony, Railings & Decking	\$15,680	\$3,763	\$627	1.54%
Building Interior - Paint, Walls & Ceiling	\$6,000	\$4,800	\$400	0.98%
Building Interior - Flooring, Tile	\$8,835	\$3,534	\$295	0.72%
Building Interior - Flooring, Dry-Dek	\$6,500	\$5,200	\$433	1.06%
Building Interior - Kitchen, Remodel	\$8,000	\$3,200	\$267	0.65%
Building Interior - Restrooms, Remodel	\$15,000	\$6,000	\$500	1.22%
Building Interior - Doors	\$3,500	\$1,400	\$117	0.29%
Building Interior - Fitness Equipment	\$8,450	\$6,760	\$845	2.07%
Building Interior - Fixtures & Furnishings	\$8,775	\$1,755	\$878	2.15%
Mechanical - HVAC, Split-System AHU	\$7,000	\$5,600	\$467	1.14%
Mechanical - HVAC, Split-System AHU	\$7,000	\$2,333	\$467	1.14%
Electrical - Security System	\$5,175	\$4,140	\$345	0.84%
Electrical - General System, Modernize	\$5,625	\$1,688	\$141	0.34%
Electrical - Light Fixtures, Interior	\$9,000	\$5,850	\$450	1.10%
Plumbing - Water Heater, 30 Gal.	\$1,275	\$765	\$64	0.16%
Plumbing - Water Heater, 85 Gal.	\$9,000	\$5,850	\$450	1.10%
Plumbing - General System, Modernize	\$26,000	\$10,400	\$867	2.12%
General Site - Metal Handrails	\$10,170	\$4,882	\$407	1.00%
<b>Pool</b>				
General Site - Pool, Concrete Deck, 5% Repair	\$5,740	\$5,740	\$1,148	2.81%

Component	Current Cost	Current Fully Funded Balance	Annual Cost	% Annual Cost
<b>Pool</b>				
General Site - Pool, Resurface, White Coat	\$21,850	\$3,121	\$3,121	7.64%
General Site - Pool, Coping, Replace	\$14,355	\$6,665	\$513	1.26%
General Site - Pool, Accessories	\$4,000	\$1,600	\$160	0.39%
General Site - Pool, Furniture	\$5,000	\$1,000	\$1,000	2.45%
General Site - Pool, Equipment	\$10,000	\$8,000	\$1,000	2.45%
General Site - Pool, Cover	\$8,048	\$6,438	\$1,610	3.94%
<b>TOTALS</b>	\$628,300	\$298,182	\$40,835	100%



# RESERVE EXPENSES 1-5 YEARS

Component	2021	2022	2023	2024	2025
<b>General Site</b>					
General Site - Paving, Asphalt Repair & Overlay	\$0	\$0	\$0	\$0	\$0
General Site - Paving, Asphalt Repair	\$14,450	\$0	\$0	\$0	\$0
General Site - Walkways, Asphalt, 10% Replace	\$0	\$0	\$0	\$0	\$0
General Site - Sidewalks, Concrete, 2% Replace	\$0	\$0	\$0	\$2,951	\$0
General Site - Curbs & Gutters, Concrete, 2% Replace	\$0	\$0	\$0	\$2,408	\$0
General Site - Stormwater System, Pond Aeration Fountain	\$0	\$12,360	\$0	\$0	\$0
General Site - Stormwater System, Repair & Maintain	\$0	\$0	\$0	\$0	\$22,510
General Site - Landscape, Tree Remove & Replace	\$0	\$0	\$5,305	\$0	\$0
General Site - Mailboxes	\$0	\$0	\$0	\$0	\$0
General Site - Signage, Entry Monuments, Repair	\$0	\$0	\$0	\$0	\$0
Building Exterior - Signage, Entry Monuments, Replace	\$0	\$0	\$0	\$0	\$0
General Site - Signage, Street & Informational	\$0	\$0	\$0	\$0	\$0
General Site - Playgrounds, Equipment & Site Furniture	\$0	\$0	\$0	\$0	\$0
General Site - Gazebo	\$0	\$0	\$0	\$0	\$0
General Site - Pedestrian Bridge, Wood	\$0	\$0	\$0	\$0	\$0
Electrical - Light Fixtures, Entry Monuments	\$0	\$0	\$0	\$2,459	\$0
Electrical - Light Fixtures, Lamp Posts, 2% Replace	\$0	\$0	\$0	\$1,464	\$0
<b>Clubhouse</b>					
Building Exterior - Roof, Metal Standing Seam	\$0	\$0	\$0	\$0	\$0
Building Exterior - Stone Veneer, 10% Repair	\$0	\$0	\$1,697	\$0	\$0
Building Exterior - Wood Trim, Repair	\$0	\$0	\$5,623	\$0	\$0
Building Exterior - Doors & Windows	\$0	\$0	\$0	\$0	\$0
Building Exterior - Balcony, Railings & Decking	\$0	\$0	\$0	\$0	\$0
Building Interior - Paint, Walls & Ceiling	\$0	\$0	\$0	\$6,556	\$0
Building Interior - Flooring, Tile	\$0	\$0	\$0	\$0	\$0
Building Interior - Flooring, Dry-Dek	\$0	\$0	\$0	\$7,103	\$0
Building Interior - Kitchen, Remodel	\$0	\$0	\$0	\$0	\$0
Building Interior - Restrooms, Remodel	\$0	\$0	\$0	\$0	\$0
Building Interior - Doors	\$0	\$0	\$0	\$0	\$0
Building Interior - Fitness Equipment	\$0	\$0	\$8,965	\$0	\$0
Building Interior - Fixtures & Furnishings	\$0	\$0	\$0	\$0	\$0
Mechanical - HVAC, Split-System AHU	\$0	\$0	\$0	\$7,649	\$0
Mechanical - HVAC, Split-System AHU	\$0	\$0	\$0	\$0	\$0
Electrical - Security System	\$0	\$0	\$0	\$5,655	\$0
Electrical - General System, Modernize	\$0	\$0	\$0	\$0	\$0
Electrical - Light Fixtures, Interior	\$0	\$0	\$0	\$0	\$0
Plumbing - Water Heater, 30 Gal.	\$0	\$0	\$0	\$0	\$0
Plumbing - Water Heater, 85 Gal.	\$0	\$0	\$0	\$0	\$0
Plumbing - General System, Modernize	\$0	\$0	\$0	\$0	\$0
General Site - Metal Handrails	\$0	\$0	\$0	\$0	\$0
<b>Pool</b>					
General Site - Pool, Concrete Deck, 5% Repair	\$5,740	\$0	\$0	\$0	\$0

Component	2021	2022	2023	2024	2025
<b>Pool</b>					
General Site - Pool, Resurface, White Coat	\$0	\$0	\$0	\$0	\$0
General Site - Pool, Coping, Replace	\$0	\$0	\$0	\$0	\$0
General Site - Pool, Accessories	\$0	\$0	\$0	\$0	\$0
General Site - Pool, Furniture	\$0	\$0	\$0	\$0	\$5,628
General Site - Pool, Equipment	\$0	\$0	\$10,609	\$0	\$0
General Site - Pool, Cover	\$0	\$8,289	\$0	\$0	\$0
Annual Expenditure	\$20,190	\$20,649	\$32,198	\$36,246	\$28,138



## RESERVE EXPENSES 6-10 YEARS

Component	2026	2027	2028	2029	2030
<b>General Site</b>					
General Site - Paving, Asphalt Repair & Overlay	\$0	\$0	\$0	\$0	\$0
General Site - Paving, Asphalt Repair	\$16,752	\$0	\$0	\$0	\$0
General Site - Walkways, Asphalt, 10% Replace	\$27,529	\$0	\$0	\$0	\$0
General Site - Sidewalks, Concrete, 2% Replace	\$0	\$0	\$0	\$3,421	\$0
General Site - Curbs & Gutters, Concrete, 2% Replace	\$0	\$0	\$0	\$2,792	\$0
General Site - Stormwater System, Pond Aeration Fountain	\$0	\$0	\$0	\$0	\$0
General Site - Stormwater System, Repair & Maintain	\$0	\$0	\$0	\$0	\$0
General Site - Landscape, Tree Remove & Replace	\$5,796	\$0	\$0	\$6,334	\$0
General Site - Mailboxes	\$0	\$0	\$0	\$0	\$8,807
General Site - Signage, Entry Monuments, Repair	\$0	\$0	\$0	\$0	\$6,524
Building Exterior - Signage, Entry Monuments, Replace	\$0	\$0	\$0	\$0	\$0
General Site - Signage, Street & Informational	\$0	\$0	\$0	\$1,938	\$0
General Site - Playgrounds, Equipment & Site Furniture	\$0	\$0	\$0	\$0	\$0
General Site - Gazebo	\$0	\$0	\$0	\$0	\$0
General Site - Pedestrian Bridge, Wood	\$0	\$0	\$0	\$0	\$0
Electrical - Light Fixtures, Entry Monuments	\$0	\$0	\$0	\$0	\$0
Electrical - Light Fixtures, Lamp Posts, 2% Replace	\$0	\$0	\$1,648	\$0	\$0
<b>Clubhouse</b>					
Building Exterior - Roof, Metal Standing Seam	\$0	\$0	\$0	\$0	\$0
Building Exterior - Stone Veneer, 10% Repair	\$0	\$0	\$0	\$0	\$0
Building Exterior - Wood Trim, Repair	\$0	\$0	\$0	\$0	\$0
Building Exterior - Doors & Windows	\$0	\$0	\$0	\$0	\$0
Building Exterior - Balcony, Railings & Decking	\$0	\$0	\$0	\$0	\$0
Building Interior - Paint, Walls & Ceiling	\$0	\$0	\$0	\$0	\$0
Building Interior - Flooring, Tile	\$0	\$0	\$0	\$0	\$0
Building Interior - Flooring, Dry-Dek	\$0	\$0	\$0	\$0	\$0
Building Interior - Kitchen, Remodel	\$0	\$0	\$0	\$0	\$0
Building Interior - Restrooms, Remodel	\$0	\$0	\$0	\$0	\$0
Building Interior - Doors	\$0	\$0	\$0	\$0	\$0
Building Interior - Fitness Equipment	\$0	\$0	\$0	\$0	\$0
Building Interior - Fixtures & Furnishings	\$0	\$0	\$0	\$11,116	\$0
Mechanical - HVAC, Split-System AHU	\$0	\$0	\$0	\$0	\$0
Mechanical - HVAC, Split-System AHU	\$0	\$0	\$0	\$0	\$0
Electrical - Security System	\$0	\$0	\$0	\$0	\$0
Electrical - General System, Modernize	\$0	\$0	\$0	\$0	\$0
Electrical - Light Fixtures, Interior	\$0	\$0	\$11,069	\$0	\$0
Plumbing - Water Heater, 30 Gal.	\$0	\$0	\$0	\$1,615	\$0
Plumbing - Water Heater, 85 Gal.	\$0	\$0	\$11,069	\$0	\$0
Plumbing - General System, Modernize	\$0	\$0	\$0	\$0	\$0
General Site - Metal Handrails	\$0	\$0	\$0	\$0	\$0
<b>Pool</b>					
General Site - Pool, Concrete Deck, 5% Repair	\$6,654	\$0	\$0	\$0	\$0

Component	2026	2027	2028	2029	2030
<b>Pool</b>					
General Site - Pool, Resurface, White Coat	\$0	\$26,090	\$0	\$0	\$0
General Site - Pool, Coping, Replace	\$0	\$0	\$0	\$0	\$0
General Site - Pool, Accessories	\$0	\$0	\$0	\$0	\$0
General Site - Pool, Furniture	\$0	\$0	\$0	\$0	\$6,524
General Site - Pool, Equipment	\$0	\$0	\$0	\$0	\$0
General Site - Pool, Cover	\$0	\$9,610	\$0	\$0	\$0
Annual Expenditure	\$56,731	\$35,700	\$23,786	\$27,216	\$21,855



## RESERVE EXPENSES 11-15 YEARS

Component	2031	2032	2033	2034	2035
<b>General Site</b>					
General Site - Paving, Asphalt Repair & Overlay	\$116,518	\$0	\$0	\$0	\$0
General Site - Paving, Asphalt Repair	\$19,420	\$0	\$0	\$0	\$0
General Site - Walkways, Asphalt, 10% Replace	\$0	\$0	\$0	\$0	\$0
General Site - Sidewalks, Concrete, 2% Replace	\$0	\$0	\$0	\$3,966	\$0
General Site - Curbs & Gutters, Concrete, 2% Replace	\$0	\$0	\$0	\$3,237	\$0
General Site - Stormwater System, Pond Aeration Fountain	\$0	\$16,611	\$0	\$0	\$0
General Site - Stormwater System, Repair & Maintain	\$0	\$0	\$0	\$0	\$30,252
General Site - Landscape, Tree Remove & Replace	\$0	\$6,921	\$0	\$0	\$7,563
General Site - Mailboxes	\$0	\$0	\$0	\$0	\$0
General Site - Signage, Entry Monuments, Repair	\$0	\$0	\$0	\$0	\$0
Building Exterior - Signage, Entry Monuments, Replace	\$0	\$0	\$0	\$0	\$0
General Site - Signage, Street & Informational	\$0	\$0	\$0	\$0	\$0
General Site - Playgrounds, Equipment & Site Furniture	\$0	\$0	\$0	\$128,497	\$0
General Site - Gazebo	\$0	\$0	\$0	\$10,280	\$0
General Site - Pedestrian Bridge, Wood	\$0	\$0	\$6,772	\$0	\$0
Electrical - Light Fixtures, Entry Monuments	\$0	\$0	\$0	\$0	\$0
Electrical - Light Fixtures, Lamp Posts, 2% Replace	\$0	\$1,855	\$0	\$0	\$0
<b>Clubhouse</b>					
Building Exterior - Roof, Metal Standing Seam	\$0	\$0	\$0	\$0	\$0
Building Exterior - Stone Veneer, 10% Repair	\$0	\$0	\$2,281	\$0	\$0
Building Exterior - Wood Trim, Repair	\$0	\$0	\$7,557	\$0	\$0
Building Exterior - Doors & Windows	\$0	\$0	\$0	\$0	\$0
Building Exterior - Balcony, Railings & Decking	\$0	\$0	\$0	\$0	\$0
Building Interior - Paint, Walls & Ceiling	\$0	\$0	\$0	\$0	\$0
Building Interior - Flooring, Tile	\$0	\$0	\$0	\$0	\$0
Building Interior - Flooring, Dry-Dek	\$0	\$0	\$0	\$0	\$0
Building Interior - Kitchen, Remodel	\$0	\$0	\$0	\$0	\$0
Building Interior - Restrooms, Remodel	\$0	\$0	\$0	\$0	\$0
Building Interior - Doors	\$0	\$0	\$0	\$0	\$0
Building Interior - Fitness Equipment	\$0	\$0	\$12,048	\$0	\$0
Building Interior - Fixtures & Furnishings	\$0	\$0	\$0	\$0	\$0
Mechanical - HVAC, Split-System AHU	\$0	\$0	\$0	\$0	\$0
Mechanical - HVAC, Split-System AHU	\$9,407	\$0	\$0	\$0	\$0
Electrical - Security System	\$0	\$0	\$0	\$0	\$0
Electrical - General System, Modernize	\$0	\$0	\$0	\$0	\$0
Electrical - Light Fixtures, Interior	\$0	\$0	\$0	\$0	\$0
Plumbing - Water Heater, 30 Gal.	\$0	\$0	\$0	\$0	\$0
Plumbing - Water Heater, 85 Gal.	\$0	\$0	\$0	\$0	\$0
Plumbing - General System, Modernize	\$0	\$0	\$0	\$0	\$0
General Site - Metal Handrails	\$0	\$0	\$0	\$14,935	\$0
<b>Pool</b>					
General Site - Pool, Concrete Deck, 5% Repair	\$7,714	\$0	\$0	\$0	\$0



Component	2031	2032	2033	2034	2035
<b>Pool</b>					
General Site - Pool, Resurface, White Coat	\$0	\$0	\$0	\$32,087	\$0
General Site - Pool, Coping, Replace	\$0	\$0	\$0	\$0	\$0
General Site - Pool, Accessories	\$0	\$0	\$0	\$0	\$0
General Site - Pool, Furniture	\$0	\$0	\$0	\$0	\$7,563
General Site - Pool, Equipment	\$0	\$0	\$14,258	\$0	\$0
General Site - Pool, Cover	\$0	\$11,140	\$0	\$0	\$0
Annual Expenditure	\$153,059	\$36,527	\$42,915	\$193,002	\$45,378



## RESERVE EXPENSES 16-20 YEARS

Component	2036	2037	2038	2039	2040
<b>General Site</b>					
General Site - Paving, Asphalt Repair & Overlay	\$0	\$0	\$0	\$0	\$0
General Site - Paving, Asphalt Repair	\$22,513	\$0	\$0	\$0	\$0
General Site - Walkways, Asphalt, 10% Replace	\$36,996	\$0	\$0	\$0	\$0
General Site - Sidewalks, Concrete, 2% Replace	\$0	\$0	\$0	\$4,598	\$0
General Site - Curbs & Gutters, Concrete, 2% Replace	\$0	\$0	\$0	\$3,752	\$0
General Site - Stormwater System, Pond Aeration Fountain	\$0	\$0	\$0	\$0	\$0
General Site - Stormwater System, Repair & Maintain	\$0	\$0	\$0	\$0	\$0
General Site - Landscape, Tree Remove & Replace	\$0	\$0	\$8,264	\$0	\$0
General Site - Mailboxes	\$0	\$0	\$0	\$0	\$0
General Site - Signage, Entry Monuments, Repair	\$0	\$0	\$0	\$0	\$8,768
Building Exterior - Signage, Entry Monuments, Replace	\$0	\$0	\$0	\$0	\$0
General Site - Signage, Street & Informational	\$0	\$0	\$0	\$0	\$0
General Site - Playgrounds, Equipment & Site Furniture	\$0	\$0	\$0	\$0	\$0
General Site - Gazebo	\$0	\$0	\$0	\$0	\$0
General Site - Pedestrian Bridge, Wood	\$0	\$0	\$0	\$0	\$0
Electrical - Light Fixtures, Entry Monuments	\$0	\$0	\$0	\$3,830	\$0
Electrical - Light Fixtures, Lamp Posts, 2% Replace	\$2,088	\$0	\$0	\$0	\$2,350
<b>Clubhouse</b>					
Building Exterior - Roof, Metal Standing Seam	\$0	\$0	\$0	\$0	\$0
Building Exterior - Stone Veneer, 10% Repair	\$0	\$0	\$0	\$0	\$0
Building Exterior - Wood Trim, Repair	\$0	\$0	\$0	\$0	\$0
Building Exterior - Doors & Windows	\$0	\$0	\$0	\$0	\$0
Building Exterior - Balcony, Railings & Decking	\$0	\$0	\$0	\$0	\$27,495
Building Interior - Paint, Walls & Ceiling	\$0	\$0	\$0	\$10,215	\$0
Building Interior - Flooring, Tile	\$0	\$0	\$0	\$15,041	\$0
Building Interior - Flooring, Dry-Dek	\$0	\$0	\$0	\$11,066	\$0
Building Interior - Kitchen, Remodel	\$0	\$0	\$0	\$13,619	\$0
Building Interior - Restrooms, Remodel	\$0	\$0	\$0	\$25,536	\$0
Building Interior - Doors	\$0	\$0	\$0	\$5,959	\$0
Building Interior - Fitness Equipment	\$0	\$0	\$0	\$0	\$0
Building Interior - Fixtures & Furnishings	\$0	\$0	\$0	\$14,939	\$0
Mechanical - HVAC, Split-System AHU	\$0	\$0	\$0	\$11,917	\$0
Mechanical - HVAC, Split-System AHU	\$0	\$0	\$0	\$0	\$0
Electrical - Security System	\$0	\$0	\$0	\$8,810	\$0
Electrical - General System, Modernize	\$0	\$0	\$0	\$0	\$0
Electrical - Light Fixtures, Interior	\$0	\$0	\$0	\$0	\$0
Plumbing - Water Heater, 30 Gal.	\$0	\$0	\$0	\$0	\$0
Plumbing - Water Heater, 85 Gal.	\$0	\$0	\$0	\$0	\$0
Plumbing - General System, Modernize	\$0	\$0	\$0	\$44,263	\$0
General Site - Metal Handrails	\$0	\$0	\$0	\$0	\$0
<b>Pool</b>					
General Site - Pool, Concrete Deck, 5% Repair	\$8,943	\$0	\$0	\$0	\$0

Component	2036	2037	2038	2039	2040
<b>Pool</b>					
General Site - Pool, Resurface, White Coat	\$0	\$0	\$0	\$0	\$0
General Site - Pool, Coping, Replace	\$22,365	\$0	\$0	\$0	\$0
General Site - Pool, Accessories	\$6,232	\$0	\$0	\$0	\$0
General Site - Pool, Furniture	\$0	\$0	\$0	\$0	\$8,768
General Site - Pool, Equipment	\$0	\$0	\$0	\$0	\$0
General Site - Pool, Cover	\$0	\$12,915	\$0	\$0	\$0
Annual Expenditure	\$99,136	\$12,915	\$8,264	\$173,546	\$47,380



## RESERVE EXPENSES 21-25 YEARS

Component	2041	2042	2043	2044	2045
<b>General Site</b>					
General Site - Paving, Asphalt Repair & Overlay	\$0	\$0	\$0	\$0	\$0
General Site - Paving, Asphalt Repair	\$26,098	\$0	\$0	\$0	\$0
General Site - Walkways, Asphalt, 10% Replace	\$0	\$0	\$0	\$0	\$0
General Site - Sidewalks, Concrete, 2% Replace	\$0	\$0	\$0	\$5,330	\$0
General Site - Curbs & Gutters, Concrete, 2% Replace	\$0	\$0	\$0	\$4,350	\$0
General Site - Stormwater System, Pond Aeration Fountain	\$0	\$22,324	\$0	\$0	\$0
General Site - Stormwater System, Repair & Maintain	\$0	\$0	\$0	\$0	\$40,656
General Site - Landscape, Tree Remove & Replace	\$9,031	\$0	\$0	\$9,868	\$0
General Site - Mailboxes	\$0	\$0	\$0	\$0	\$0
General Site - Signage, Entry Monuments, Repair	\$0	\$0	\$0	\$0	\$0
Building Exterior - Signage, Entry Monuments, Replace	\$0	\$0	\$0	\$0	\$0
General Site - Signage, Street & Informational	\$0	\$0	\$0	\$0	\$0
General Site - Playgrounds, Equipment & Site Furniture	\$0	\$0	\$0	\$0	\$0
General Site - Gazebo	\$0	\$0	\$0	\$0	\$0
General Site - Pedestrian Bridge, Wood	\$0	\$0	\$0	\$0	\$0
Electrical - Light Fixtures, Entry Monuments	\$0	\$0	\$0	\$0	\$0
Electrical - Light Fixtures, Lamp Posts, 2% Replace	\$0	\$0	\$0	\$2,645	\$0
<b>Clubhouse</b>					
Building Exterior - Roof, Metal Standing Seam	\$0	\$0	\$0	\$0	\$0
Building Exterior - Stone Veneer, 10% Repair	\$0	\$0	\$3,066	\$0	\$0
Building Exterior - Wood Trim, Repair	\$0	\$0	\$10,155	\$0	\$0
Building Exterior - Doors & Windows	\$0	\$0	\$0	\$0	\$0
Building Exterior - Balcony, Railings & Decking	\$0	\$0	\$0	\$0	\$0
Building Interior - Paint, Walls & Ceiling	\$0	\$0	\$0	\$0	\$0
Building Interior - Flooring, Tile	\$0	\$0	\$0	\$0	\$0
Building Interior - Flooring, Dry-Dek	\$0	\$0	\$0	\$0	\$0
Building Interior - Kitchen, Remodel	\$0	\$0	\$0	\$0	\$0
Building Interior - Restrooms, Remodel	\$0	\$0	\$0	\$0	\$0
Building Interior - Doors	\$0	\$0	\$0	\$0	\$0
Building Interior - Fitness Equipment	\$0	\$0	\$16,191	\$0	\$0
Building Interior - Fixtures & Furnishings	\$0	\$0	\$0	\$0	\$0
Mechanical - HVAC, Split-System AHU	\$0	\$0	\$0	\$0	\$0
Mechanical - HVAC, Split-System AHU	\$0	\$0	\$0	\$0	\$0
Electrical - Security System	\$0	\$0	\$0	\$0	\$0
Electrical - General System, Modernize	\$0	\$0	\$0	\$0	\$0
Electrical - Light Fixtures, Interior	\$0	\$0	\$0	\$0	\$0
Plumbing - Water Heater, 30 Gal.	\$0	\$0	\$0	\$0	\$0
Plumbing - Water Heater, 85 Gal.	\$0	\$0	\$0	\$0	\$0
Plumbing - General System, Modernize	\$0	\$0	\$0	\$0	\$0
General Site - Metal Handrails	\$0	\$0	\$0	\$0	\$0
<b>Pool</b>					
General Site - Pool, Concrete Deck, 5% Repair	\$10,367	\$0	\$0	\$0	\$0

Component	2041	2042	2043	2044	2045
<b>Pool</b>					
General Site - Pool, Resurface, White Coat	\$39,464	\$0	\$0	\$0	\$0
General Site - Pool, Coping, Replace	\$0	\$0	\$0	\$0	\$0
General Site - Pool, Accessories	\$0	\$0	\$0	\$0	\$0
General Site - Pool, Furniture	\$0	\$0	\$0	\$0	\$10,164
General Site - Pool, Equipment	\$0	\$0	\$19,161	\$0	\$0
General Site - Pool, Cover	\$0	\$14,972	\$0	\$0	\$0
Annual Expenditure	\$84,960	\$37,295	\$48,573	\$22,193	\$50,820



## RESERVE EXPENSES 26-30 YEARS



Component	2046	2047	2048	2049	2050
<b>General Site</b>					
General Site - Paving, Asphalt Repair & Overlay	\$0	\$0	\$0	\$0	\$0
General Site - Paving, Asphalt Repair	\$30,255	\$0	\$0	\$0	\$0
General Site - Walkways, Asphalt, 10% Replace	\$49,720	\$0	\$0	\$0	\$0
General Site - Sidewalks, Concrete, 2% Replace	\$0	\$0	\$0	\$6,179	\$0
General Site - Curbs & Gutters, Concrete, 2% Replace	\$0	\$0	\$0	\$5,043	\$0
General Site - Stormwater System, Pond Aeration Fountain	\$0	\$0	\$0	\$0	\$0
General Site - Stormwater System, Repair & Maintain	\$0	\$0	\$0	\$0	\$0
General Site - Landscape, Tree Remove & Replace	\$0	\$10,783	\$0	\$0	\$11,783
General Site - Mailboxes	\$0	\$0	\$0	\$0	\$15,907
General Site - Signage, Entry Monuments, Repair	\$0	\$0	\$0	\$0	\$11,783
Building Exterior - Signage, Entry Monuments, Replace	\$0	\$0	\$0	\$0	\$94,263
General Site - Signage, Street & Informational	\$0	\$0	\$0	\$3,501	\$0
General Site - Playgrounds, Equipment & Site Furniture	\$0	\$0	\$0	\$0	\$0
General Site - Gazebo	\$0	\$0	\$0	\$0	\$0
General Site - Pedestrian Bridge, Wood	\$0	\$0	\$0	\$0	\$0
Electrical - Light Fixtures, Entry Monuments	\$0	\$0	\$0	\$0	\$0
Electrical - Light Fixtures, Lamp Posts, 2% Replace	\$0	\$0	\$2,977	\$0	\$0
<b>Clubhouse</b>					
Building Exterior - Roof, Metal Standing Seam	\$0	\$0	\$0	\$92,661	\$0
Building Exterior - Stone Veneer, 10% Repair	\$0	\$0	\$0	\$0	\$0
Building Exterior - Wood Trim, Repair	\$0	\$0	\$0	\$0	\$0
Building Exterior - Doors & Windows	\$0	\$0	\$0	\$64,062	\$0
Building Exterior - Balcony, Railings & Decking	\$0	\$0	\$0	\$0	\$0
Building Interior - Paint, Walls & Ceiling	\$0	\$0	\$0	\$0	\$0
Building Interior - Flooring, Tile	\$0	\$0	\$0	\$0	\$0
Building Interior - Flooring, Dry-Dek	\$0	\$0	\$0	\$0	\$0
Building Interior - Kitchen, Remodel	\$0	\$0	\$0	\$0	\$0
Building Interior - Restrooms, Remodel	\$0	\$0	\$0	\$0	\$0
Building Interior - Doors	\$0	\$0	\$0	\$0	\$0
Building Interior - Fitness Equipment	\$0	\$0	\$0	\$0	\$0
Building Interior - Fixtures & Furnishings	\$0	\$0	\$0	\$20,077	\$0
Mechanical - HVAC, Split-System AHU	\$0	\$0	\$0	\$0	\$0
Mechanical - HVAC, Split-System AHU	\$14,656	\$0	\$0	\$0	\$0
Electrical - Security System	\$0	\$0	\$0	\$0	\$0
Electrical - General System, Modernize	\$0	\$0	\$0	\$12,870	\$0
Electrical - Light Fixtures, Interior	\$0	\$0	\$19,992	\$0	\$0
Plumbing - Water Heater, 30 Gal.	\$0	\$0	\$0	\$2,917	\$0
Plumbing - Water Heater, 85 Gal.	\$0	\$0	\$19,992	\$0	\$0
Plumbing - General System, Modernize	\$0	\$0	\$0	\$0	\$0
General Site - Metal Handrails	\$0	\$0	\$0	\$0	\$0
<b>Pool</b>					
General Site - Pool, Concrete Deck, 5% Repair	\$12,019	\$0	\$0	\$0	\$0

Component	2046	2047	2048	2049	2050
<b>Pool</b>					
General Site - Pool, Resurface, White Coat	\$0	\$0	\$48,535	\$0	\$0
General Site - Pool, Coping, Replace	\$0	\$0	\$0	\$0	\$0
General Site - Pool, Accessories	\$0	\$0	\$0	\$0	\$0
General Site - Pool, Furniture	\$0	\$0	\$0	\$0	\$11,783
General Site - Pool, Equipment	\$0	\$0	\$0	\$0	\$0
General Site - Pool, Cover	\$0	\$17,356	\$0	\$0	\$0
Annual Expenditure	\$106,650	\$28,139	\$91,495	\$207,309	\$145,518



# FULL FUNDING PLAN 1-10 YEARS

YEAR 1-10	2021	2022	2023	2024	2025	2026	2027	2028	2029	2030
Fully Funded Balance	\$298,182	\$328,392	\$360,296	\$382,563	\$402,667	\$433,104	\$436,423	\$462,967	\$504,085	\$544,456
Percentage Funded (%)	81%	84%	85%	87%	87%	89%	89%	90%	91%	91%
Beginning Balance	\$242,870	\$274,646	\$307,766	\$331,146	\$352,271	\$383,383	\$387,746	\$415,016	\$456,310	\$496,400
Reserve Contribution	\$49,391	\$50,873	\$52,399	\$53,971	\$55,590	\$57,258	\$58,975	\$60,745	\$62,567	\$64,444
Avg Unit Contribution (mth)	\$12.70	\$13.08	\$13.48	\$13.88	\$14.30	\$14.73	\$15.17	\$15.62	\$16.09	\$16.58
Contribution Increase (%)	0.00%	3.00%	3.00%	3.00%	3.00%	3.00%	3.00%	3.00%	3.00%	3.00%
Special Assessment	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
Interest Earned	\$2,575	\$2,898	\$3,179	\$3,400	\$3,660	\$3,836	\$3,994	\$4,335	\$4,740	\$5,177
Reserve Expenditures	\$20,190	\$20,649	\$32,198	\$36,246	\$28,138	\$56,731	\$35,700	\$23,786	\$27,216	\$21,855
ENDING BALANCE	\$274,646	\$307,766	\$331,146	\$352,271	\$383,383	\$387,746	\$415,016	\$456,310	\$496,400	\$544,166

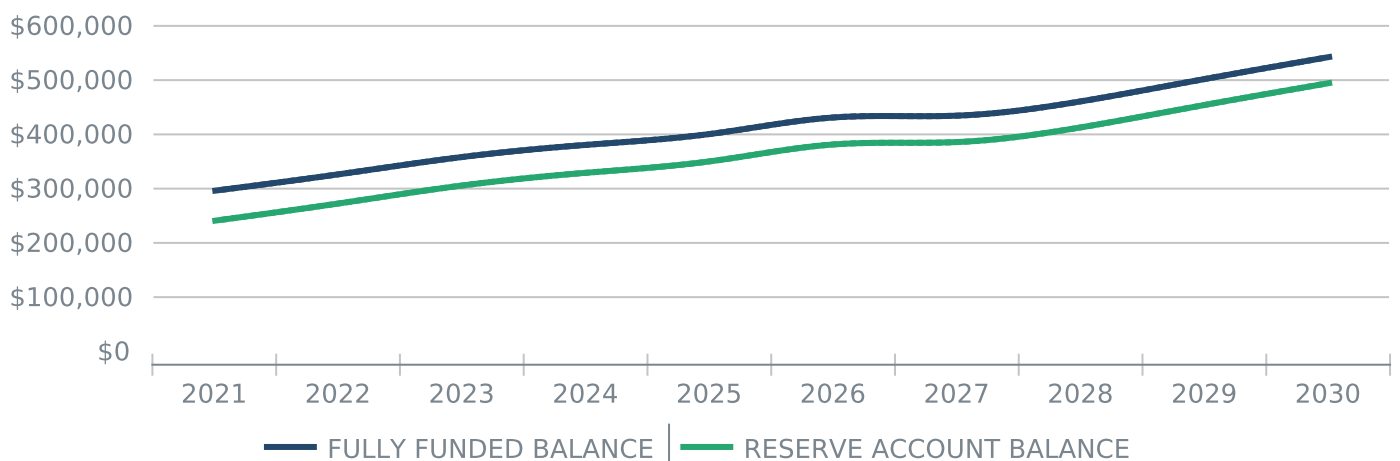
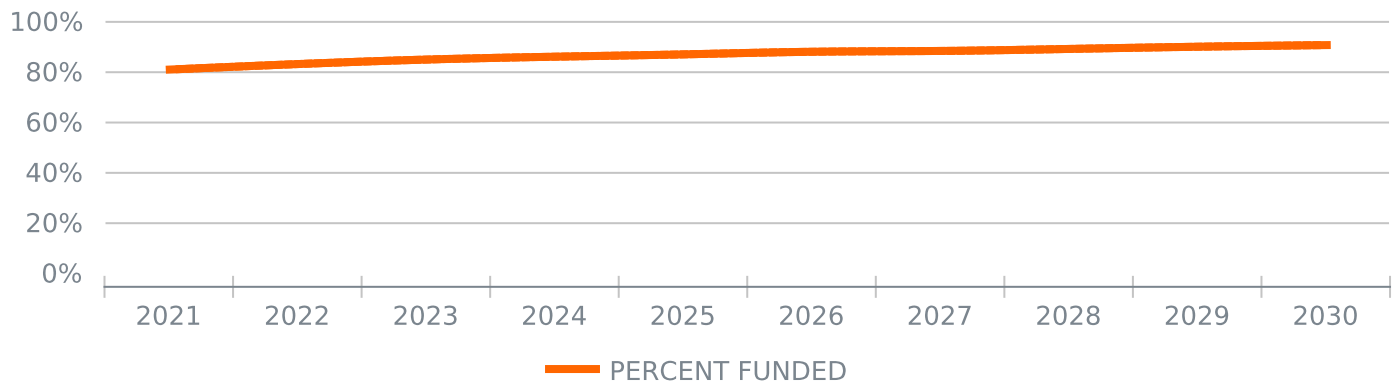






# FULL FUNDING PLAN 11-20 YEARS



YEAR 11-20	2031	2032	2033	2034	2035	2036	2037	2038	2039	2040
Fully Funded Balance	\$593,158	\$509,827	\$545,720	\$577,856	\$458,167	\$488,793	\$466,874	\$535,073	\$612,132	\$523,348
Percentage Funded (%)	92%	91%	91%	92%	91%	92%	92%	94%	95%	95%
Beginning Balance	\$544,166	\$462,493	\$499,119	\$531,752	\$415,998	\$449,635	\$431,834	\$502,827	\$581,594	\$497,501
Reserve Contribution	\$66,377	\$68,369	\$70,420	\$72,532	\$74,708	\$76,950	\$79,258	\$81,636	\$84,085	\$86,607
Avg Unit Contribution (mth)	\$17.07	\$17.58	\$18.11	\$18.66	\$19.22	\$19.79	\$20.39	\$21.00	\$21.63	\$22.28
Contribution Increase (%)	3.00%	3.00%	3.00%	3.00%	3.00%	3.00%	3.00%	3.00%	3.00%	3.00%
Special Assessment	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
Interest Earned	\$5,008	\$4,784	\$5,129	\$4,715	\$4,307	\$4,385	\$4,650	\$5,395	\$5,369	\$5,171
Reserve Expenditures	\$153,059	\$36,527	\$42,915	\$193,002	\$45,378	\$99,136	\$12,915	\$8,264	\$173,546	\$47,380
<b>ENDING BALANCE</b>	<b>\$462,493</b>	<b>\$499,119</b>	<b>\$531,752</b>	<b>\$415,998</b>	<b>\$449,635</b>	<b>\$431,834</b>	<b>\$502,827</b>	<b>\$581,594</b>	<b>\$497,501</b>	<b>\$541,900</b>

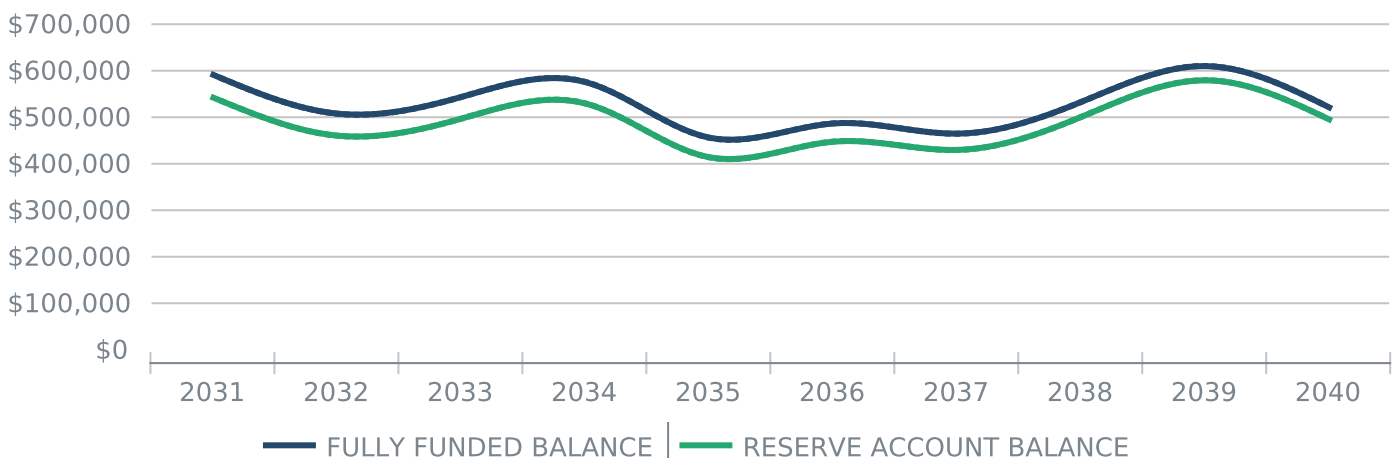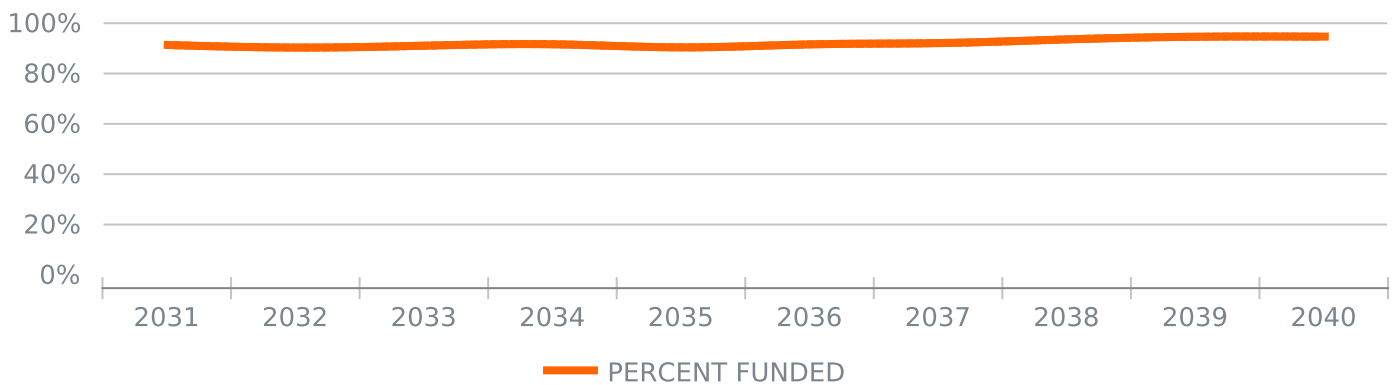



# FULL FUNDING PLAN 21-30 YEARS

YEAR 21-30	2041	2042	2043	2044	2045	2046	2047	2048	2049	2050
Fully Funded Balance	\$564,000	\$569,377	\$626,288	\$675,638	\$756,058	\$811,895	\$814,467	\$900,624	\$926,830	\$837,338
Percentage Funded (%)	96%	97%	98%	98%	99%	99%	99%	99%	100%	100%
Beginning Balance	\$541,900	\$551,586	\$611,962	\$664,377	\$746,682	\$803,978	\$808,766	\$895,622	\$922,886	\$837,338
Reserve Contribution	\$89,206	\$91,882	\$94,638	\$97,477	\$100,402	\$103,414	\$106,516	\$109,712	\$113,003	\$116,393
Avg Unit Contribution (mth)	\$22.94	\$23.63	\$24.34	\$25.07	\$25.82	\$26.60	\$27.40	\$28.22	\$29.06	\$29.94
Contribution Increase (%)	3.00%	3.00%	3.00%	3.00%	3.00%	3.00%	3.00%	3.00%	3.00%	3.00%
Special Assessment	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
Interest Earned	\$5,440	\$5,789	\$6,350	\$7,020	\$7,715	\$8,024	\$8,480	\$9,047	\$8,757	\$8,228
Reserve Expenditures	\$84,960	\$37,295	\$48,573	\$22,193	\$50,820	\$106,650	\$28,139	\$91,495	\$207,309	\$145,518
<b>ENDING BALANCE</b>	<b>\$551,586</b>	<b>\$611,962</b>	<b>\$664,377</b>	<b>\$746,682</b>	<b>\$803,978</b>	<b>\$808,766</b>	<b>\$895,622</b>	<b>\$922,886</b>	<b>\$837,338</b>	<b>\$816,441</b>

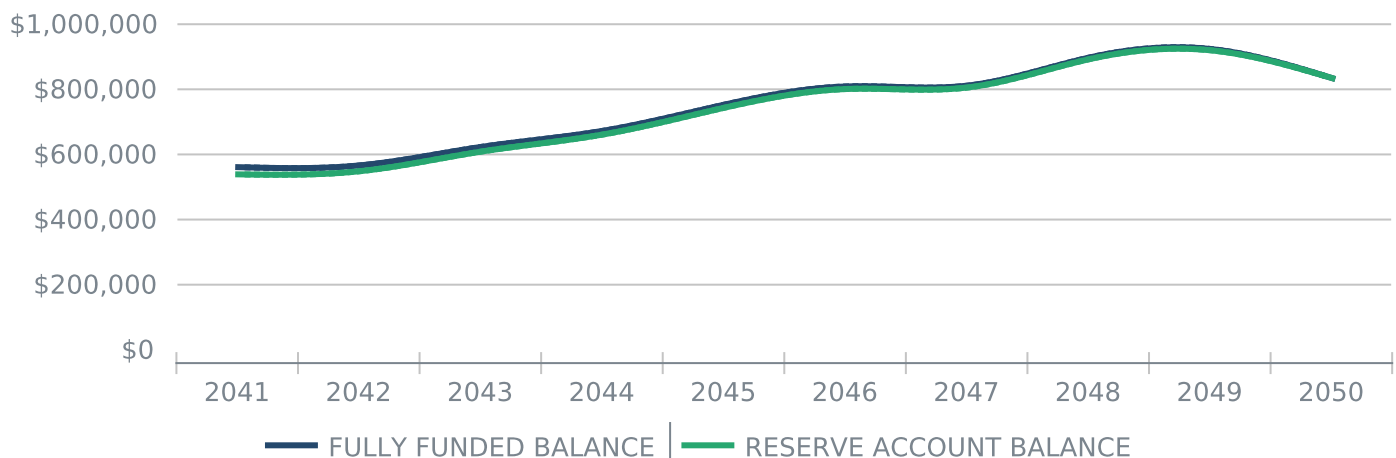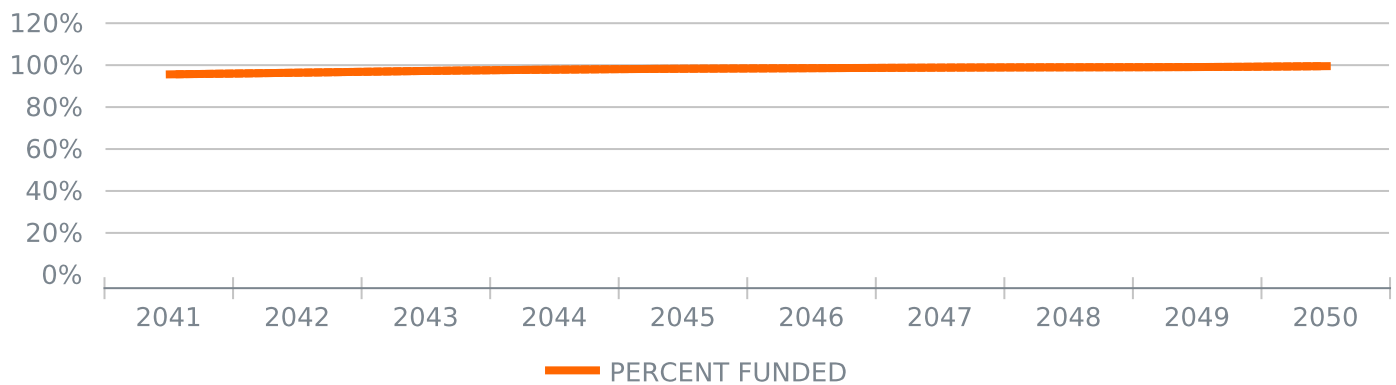



## PHYSICAL ANALYSIS

---

This section of the report provides specific information regarding the physical condition of the property and common area assets. The data that follows is a result of the visual [non-intrusive] site review.

---

### SITE INSPECTION

An on-site field survey was conducted to assess the general condition of the property and its reserve components. The survey was visual in nature, and no destructive or invasive testing was conducted. Observations were recorded using a representative sampling of the Association's common areas and reserve components. The component inventory and associated field measurements were also substantiated as part of the inspection. Due to the general and non-invasive nature of the site inspection, RSG cannot comment on components and conditions not visible to the naked eye.

### MAINTENANCE GUIDE

The Maintenance guide focuses on reserve components that account for a significant percentage of the Association's reserve fund budget. Ongoing review and maintenance of all common area assets is generally recommended, although in some cases it is critical that such activities occur on a frequent and regular basis. Condition and performance of the Association's common areas assets is contingent on the implementation of a comprehensive program of preventative maintenance.

### COMPONENT INVENTORY

The component inventory summarizes associated costs of each reserve component, and additionally highlights those components which require further review. The inventory provides a visual reference point for understanding the Association 's common area responsibilities.



## SITE INSPECTION SUMMARY

A visual noninvasive inspection of the property was conducted on February 11th 2021. Recommendations contained within the report are based upon conditions viewed as part of the site inspection as well as reference materials obtained from the client, public resources and associated vendors.





# COMPONENT INVENTORY

The following inventory summarizes the key data points of each reserve component funded through the Association's reserves. The list of components is unique to the Association and may serve as a general guide in determining the current condition and level of care needed to adequately maintain each component.

## General Site - Paving, Asphalt Repair & Overlay

<b>Current Cost</b> \$86,700	<b>Estimated Quantity</b> 5780 SY	<b>Work Required</b> Overlay	<b>Action Required</b> 2031
---------------------------------	---	---------------------------------	--------------------------------

## General Site - Paving, Asphalt Repair

<b>Current Cost</b> \$14,450	<b>Estimated Quantity</b> 5780 SY	<b>Work Required</b> Maintain	<b>Action Required</b> 2021
---------------------------------	---	----------------------------------	--------------------------------



## General Site - Walkways, Asphalt, 10% Replace

<b>Current Cost</b> \$23,747	<b>Estimated Quantity</b> 5277 SY	<b>Work Required</b> Repair	<b>Action Required</b> 2026
---------------------------------	---	--------------------------------	--------------------------------

# COMPONENT INVENTORY



## General Site - Sidewalks, Concrete, 2% Replace

Current Cost	Estimated Quantity	Work Required	Action Required
\$2,701	12004 SF	Repair	2024

## General Site - Curbs & Gutters, Concrete, 2% Replace

Current Cost	Estimated Quantity	Work Required	Action Required
\$2,204	2755 LF	Repair	2024

## General Site - Stormwater System, Pond Aeration Fountain

Current Cost	Estimated Quantity	Work Required	Action Required
\$12,000	1 Lump Sum	Replace	2022



## General Site - Stormwater System, Repair & Maintain

Current Cost	Estimated Quantity	Work Required	Action Required
\$20,000	1 Allowance	Maintain	2025

# COMPONENT INVENTORY



## General Site - Landscape, Tree Remove & Replace

<b>Current Cost</b> \$5,000	<b>Estimated Quantity</b> 1 Allowance	<b>Work Required</b> Replace	<b>Action Required</b> 2023
--------------------------------	---	---------------------------------	--------------------------------

## General Site - Mailboxes

<b>Current Cost</b> \$6,750	<b>Estimated Quantity</b> 3 Each	<b>Work Required</b> Replace	<b>Action Required</b> 2030
--------------------------------	--	---------------------------------	--------------------------------



## General Site - Signage, Entry Monuments, Repair

<b>Current Cost</b> \$5,000	<b>Estimated Quantity</b> 1 Allowance	<b>Work Required</b> Repair	<b>Action Required</b> 2030
--------------------------------	---	--------------------------------	--------------------------------

## Building Exterior - Signage, Entry Monuments, Replace

<b>Current Cost</b> \$40,000	<b>Estimated Quantity</b> 1 Lump Sum	<b>Work Required</b> Replace	<b>Action Required</b> 2050
---------------------------------	--	---------------------------------	--------------------------------

# COMPONENT INVENTORY



## General Site - Signage, Street & Informational

Current Cost	Estimated Quantity	Work Required	Action Required
\$1,530	9 Each	Replace	2029



## General Site - Playgrounds, Equipment & Site Furniture

Current Cost	Estimated Quantity	Work Required	Action Required
\$87,500	5 Each	Replace	2034



# COMPONENT INVENTORY



## General Site - Gazebo

Current Cost	Estimated Quantity	Work Required	Action Required
\$7,000	1 Allowance	Replace	2034



## General Site - Pedestrian Bridge, Wood

Current Cost	Estimated Quantity	Work Required	Action Required
\$4,750	1 Allowance	Replace	2033

# COMPONENT INVENTORY



## Electrical - Light Fixtures, Entry Monuments

<b>Current Cost</b> \$2,250	<b>Estimated Quantity</b> 1 Allowance	<b>Work Required</b> Replace	<b>Action Required</b> 2024
--------------------------------	---	---------------------------------	--------------------------------

## Electrical - Light Fixtures, Lamp Posts, 2% Replace

<b>Current Cost</b> \$1,340	<b>Estimated Quantity</b> 134 Each	<b>Work Required</b> Replace	<b>Action Required</b> 2024
--------------------------------	--	---------------------------------	--------------------------------

## Building Exterior - Roof, Metal Standing Seam

<b>Current Cost</b> \$40,500	<b>Estimated Quantity</b> 27 Squares	<b>Work Required</b> Replace	<b>Action Required</b> 2049
---------------------------------	--	---------------------------------	--------------------------------



## Building Exterior - Stone Veneer, 10% Repair

<b>Current Cost</b> \$1,600	<b>Estimated Quantity</b> 1 Lump Sum	<b>Work Required</b> Repair	<b>Action Required</b> 2023
--------------------------------	--	--------------------------------	--------------------------------

# COMPONENT INVENTORY



## Building Exterior - Wood Trim, Repair

<b>Current Cost</b> \$5,300	<b>Estimated Quantity</b> 1 Lump Sum	<b>Work Required</b> Repair	<b>Action Required</b> 2023
--------------------------------	--	--------------------------------	--------------------------------

## Building Exterior - Doors & Windows

<b>Current Cost</b> \$28,000	<b>Estimated Quantity</b> 1 Lump Sum	<b>Work Required</b> Replace	<b>Action Required</b> 2049
---------------------------------	--	---------------------------------	--------------------------------

## Building Exterior - Balcony, Railings & Decking

<b>Current Cost</b> \$15,680	<b>Estimated Quantity</b> 448 SF	<b>Work Required</b> Replace	<b>Action Required</b> 2040
---------------------------------	--	---------------------------------	--------------------------------


## Building Interior - Paint, Walls & Ceiling

<b>Current Cost</b> \$6,000	<b>Estimated Quantity</b> 1 Lump Sum	<b>Work Required</b> Paint	<b>Action Required</b> 2024
--------------------------------	--	-------------------------------	--------------------------------

## Building Interior - Flooring, Tile

<b>Current Cost</b> \$8,835	<b>Estimated Quantity</b> 589 SF	<b>Work Required</b> Replace	<b>Action Required</b> 2039
--------------------------------	--	---------------------------------	--------------------------------

# COMPONENT INVENTORY

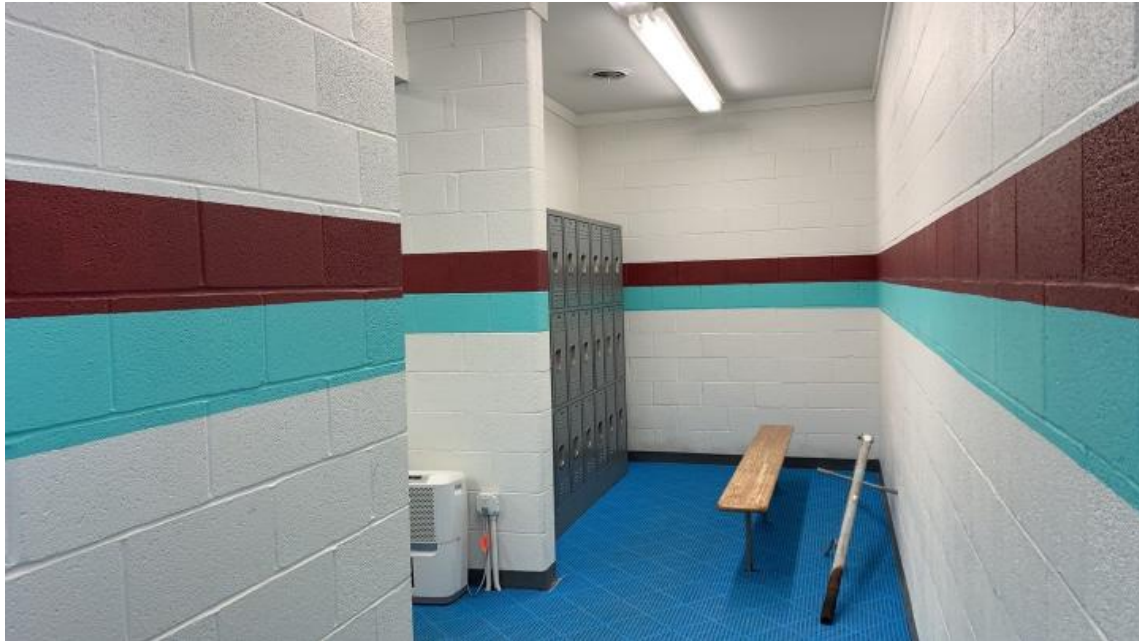

**Building Interior - Flooring, Dry-Dek**

Current Cost	Estimated Quantity	Work Required	Action Required
\$6,500	1040 SF	Replace	2024



**Building Interior - Kitchen, Remodel**

Current Cost	Estimated Quantity	Work Required	Action Required
\$8,000	1 Lump Sum	Remodel	2039

# COMPONENT INVENTORY



## Building Interior - Restrooms, Remodel

<b>Current Cost</b> \$15,000	<b>Estimated Quantity</b> 1 Lump Sum	<b>Work Required</b> Remodel	<b>Action Required</b> 2039
---------------------------------	--	---------------------------------	--------------------------------

## Building Interior - Doors

<b>Current Cost</b> \$3,500	<b>Estimated Quantity</b> 5 Each	<b>Work Required</b> Replace	<b>Action Required</b> 2039
--------------------------------	--	---------------------------------	--------------------------------

# COMPONENT INVENTORY



## Building Interior - Fitness Equipment

<b>Current Cost</b> \$8,450	<b>Estimated Quantity</b> 1 Lump Sum	<b>Work Required</b> Replace	<b>Action Required</b> 2023
--------------------------------	--	---------------------------------	--------------------------------

## Building Interior - Fixtures & Furnishings

<b>Current Cost</b> \$8,775	<b>Estimated Quantity</b> 1 Allowance	<b>Work Required</b> Replace	<b>Action Required</b> 2029
--------------------------------	---	---------------------------------	--------------------------------

## Mechanical - HVAC, Split-System AHU

<b>Current Cost</b> \$7,000	<b>Estimated Quantity</b> 1 Each	<b>Work Required</b> Replace	<b>Action Required</b> 2024
--------------------------------	--	---------------------------------	--------------------------------

# COMPONENT INVENTORY



## Mechanical - HVAC, Split-System AHU

Current Cost	Estimated Quantity	Work Required	Action Required
\$7,000	1 Each	Replace	2031

## Electrical - Security System

Current Cost	Estimated Quantity	Work Required	Action Required
\$5,175	1 Lump Sum	Replace	2024

## Electrical - General System, Modernize

Current Cost	Estimated Quantity	Work Required	Action Required
\$5,625	1 Allowance	Modernize	2049

# COMPONENT INVENTORY



## Electrical - Light Fixtures, Interior

<b>Current Cost</b> \$9,000	<b>Estimated Quantity</b> 40 Each	<b>Work Required</b> Replace	<b>Action Required</b> 2028
--------------------------------	---	---------------------------------	--------------------------------

## Plumbing - Water Heater, 30 Gal.

<b>Current Cost</b> \$1,275	<b>Estimated Quantity</b> 1 Each	<b>Work Required</b> Replace	<b>Action Required</b> 2029
--------------------------------	--	---------------------------------	--------------------------------

## Plumbing - Water Heater, 85 Gal.

<b>Current Cost</b> \$9,000	<b>Estimated Quantity</b> 1 Each	<b>Work Required</b> Replace	<b>Action Required</b> 2028
--------------------------------	--	---------------------------------	--------------------------------

## Plumbing - General System, Modernize

<b>Current Cost</b> \$26,000	<b>Estimated Quantity</b> 1 Lump Sum	<b>Work Required</b> Modernize	<b>Action Required</b> 2039
---------------------------------	--	-----------------------------------	--------------------------------



# COMPONENT INVENTORY



## General Site - Metal Handrails

Current Cost	Estimated Quantity	Work Required	Action Required
\$10,170	226 LF	Replace	2034



## General Site - Pool, Concrete Deck, 5% Repair

Current Cost	Estimated Quantity	Work Required	Action Required
\$5,740	8504 SF	Repair	2021

# COMPONENT INVENTORY



## General Site - Pool, Resurface, White Coat

<b>Current Cost</b> \$21,850	<b>Estimated Quantity</b> 3496 SF	<b>Work Required</b> Resurface	<b>Action Required</b> 2027
---------------------------------	---	-----------------------------------	--------------------------------

## General Site - Pool, Coping, Replace

<b>Current Cost</b> \$14,355	<b>Estimated Quantity</b> 319 LF	<b>Work Required</b> Replace	<b>Action Required</b> 2036
---------------------------------	--	---------------------------------	--------------------------------

## General Site - Pool, Accessories

<b>Current Cost</b> \$4,000	<b>Estimated Quantity</b> 1 Lump Sum	<b>Work Required</b> Replace	<b>Action Required</b> 2036
--------------------------------	--	---------------------------------	--------------------------------

# COMPONENT INVENTORY



**General Site - Pool, Furniture**

**Current Cost**  
\$5,000

**Estimated Quantity**  
1  
Allowance

**Work Required**  
Replace

**Action Required**  
2025



**General Site - Pool, Equipment**

**Current Cost**  
\$10,000

**Estimated Quantity**  
1  
Allowance

**Work Required**  
Replace

**Action Required**  
2023

# COMPONENT INVENTORY



## General Site - Pool, Cover

Current Cost	Estimated Quantity	Work Required	Action Required
\$8,048	2012 SF	Replace	2022



## DISCLOSURES

As a guideline for establishing and spending reserves, it is assumed that the reserve study will be regularly updated to address the Association's changing physical and financial circumstances. As such this report is valid at the date shown and Reserve Study Group, LLC (RSG) cannot be held responsible for subsequent changes in physical/chemical environmental conditions and/or legislation over which we have no control.

This reserve study is based on visual inspections of the physical plant's major components. No invasive or destructive testing, or testing of materials was conducted during the inspections, or at any other time during the preparation of this report. It is assumed that all building and ancillary components have been designed and constructed properly and that life cycles will approximate normal industry performance standards. RSG shall not be responsible for accurate determination of remaining life expectancies of components that may have been improperly designed and constructed. Our opinions of the remaining life expectancy of the property's components do not represent a guarantee or warranty of performance in relation to the product, materials or workmanship.

Cost estimates used represent a preliminary opinion only and are neither a quote nor a warranty of actual costs that may be incurred. These estimates are based on typical cost data that may not fully characterize the scope of the underlying property conditions. It should be anticipated that actual cost outcomes will be impacted by varying physical and economic conditions, maintenance practices, changes in technology, and future regulatory actions.

The authors of this report make no representation or warranty, expressed or implied, with respect to the contents of this publication or any part thereof and cannot accept any legal responsibility or liability for any inaccuracies, errors or omissions contained in this publication or any part thereof. Our best professional judgment has been used, however certain facts forming the basis of this report are subject to professional interpretation and differing conclusions could be reached.

RSG nor any of its representatives, agents or employees maintain management roles or vested interest in, or have other business relationships with the Association. There is no perceived or actual conflicts of interest between RSG and the Association. Our reserve studies are prepared by a reserve study professional and also comply with the requirements of the Washington Unified Common Interest Act (WUCIOA).

This reserve study should be reviewed carefully. It may not include all common and limited common element components that will require major maintenance, repair, or replacement in future years, and may not include regular contributions to a reserve account for the cost of such maintenance, repair, or replacement. The failure to include a component in a reserve study, or to provide contributions to a reserve account for a component, may, under some circumstances, require the association to (1) defer major maintenance, repair, or replacement, (2) increase future reserve contributions, (3) borrow funds to pay for major maintenance, repair, or replacement, or (4) impose special assessments for the cost of major maintenance, repair, or replacement.



# GLOSSARY OF TERMS

## *Component*

The individual line items in the Reserve Study which are included in the Physical Analysis. These elements form the building blocks for the Reserve Study.

## *Estimated Useful Life*

The estimated time, in years, that a reserve component can be expected to serve its intended function if properly constructed in its present application or installation.

## *Fully Funded*

When the actual (or projected) Reserve balance is equal to the Fully Funded Balance.

## *Fully Funded Balance (FFB)*

The Reserve balance that is in direct proportion to the fraction of life “used up” of the current Repair or Replacement cost. This number is calculated for each component, then summed together for an Association total.

$FFB = \text{Current Cost} \times \text{Effective Age} / \text{Useful Life}$

## *Percent Funded*

The ratio, at a particular point of time, of the actual Reserve Balance to the Fully Funded Balance (FFB), expressed as a percentage.

## *Remaining Useful Life*

The estimated time, in years, that a Reserve Component can be expected to continue to service its intended function. Projects anticipated to occur in the initial year have a “zero” Remaining Life.

## *Unit Cost Estimate*

The cost of replacing, repairing, or restoring a Reserve Component to its original functional condition. The Current Replacement Cost would be the cost to replace, repair, or restore the component during the current year.

## *Unit of Measure*

Various units of measure have been used to quantify the amounts and costs in relation to each reserve component. Below are the key units used as part of this report.

SF = Square Foot

SY = Square Yard

LF = Linear Foot

SQUARE = 100 Square Feet (Roofing)

